

Department of Energy National Nuclear Security Administration Sandia Field Office

P. O. Box 5400 Albuquerque, NM 87185

FEB 1 8 2015



FEB 19 2015

NMED Hazardous Waste Bureau

Mr. John E. Kieling Chief New Mexico Environment Department Hazardous Waste Bureau 2905 Rodeo Park Dr. East, Bldg. 1 Santa Fe, NM 87505

Subject:

Submittal of Updated Reference Documents Cited in the Mixed Waste Landfill (MWL)

Long-Term Monitoring and Maintenance Plan (LTMMP) for Sandia National

Laboratories/New Mexico (SNL/NM), Environmental Protection Agency Identification

Number NM5890110518

Dear Mr. Kieling:

The Department of Energy/National Nuclear Security Administration and Sandia Corporation (Sandia) are submitting the enclosed reference documents to the New Mexico Environment Department (NMED). This submittal is required within 30 days of the effective date of the updated documents, which is January 23, 2015.

This submittal includes five documents used by SNL/NM personnel to perform groundwater monitoring activities at the CWL. The updated reference documents are:

- FOP 05-01 Groundwater Monitoring Well Sampling and Field Analytical Measurements
- FOP 05-02 Groundwater Monitoring Equipment Field Check for Water Quality Measurements
- FOP 05-03 Groundwater Monitoring Equipment Decontamination
- FOP-05-04 Groundwater Monitoring Waste Management
- PLA 05-09 Groundwater Monitoring Health and Safety Plan

Revisions include updates to keep the reference documents current and to reflect ongoing modifications and improvements in industry practices. The revised reference documents became effective on November 12, 2013.

If you have questions, please contact John Weckerle of my staff at (505) 845-6026

Sincerely,

James W. Todd

Assistant Manager for Engineering

Enclosure and cc: See Page 2

Enclosure Certification Statement

] How with Clost life

David Cobrain

Manager, Permits Management Program

Hazardous Waste Bureau

New Mexico Environment Department

2905 Rodeo Park Dr. East, Bldg. 1, Santa Fe, NM 87505

นะลามซี เรื่องW สมอธาธารษ William Moats

Hazardous Waste Bureau

New Mexico Environment Department

5500 San Antonio Dr. NE, Albuquerque, NM 87109

Brian Salem

Hazardous Waste Bureau

New Mexico Environment Department

5500 San Antonio Dr. NE, Albuquerque, NM 87109

Susan Lucas Kamat

Chief, DOE Oversight Bureau

New Mexico Environment Department

P.O. Box 5400, MS-1396, Albuquerque, NM 87185-5400

Laurie King

United States Environmental Protection Agency Region 6

Fountain Place Suite 1200

1445 Ross Ave., Dallas, TX 75202

Zimmerman Library

MSC05 3020

1 University of New Mexico, Albuquerque, NM 87101-0001

SNL Customer Funded Record Center, MS-0651

SFO Legal File

SFO Waste Management File

cc w/o enclosure:

Amy Blumberg, SNL/NM

Michael Hazen, SNL/NM

Sidney Gutierrez, SNL/NM

Pamela Puissant, SNL/NM

Anita Reiser, SNL/NM

Robert Ziock, SNL/NM

Daniel Pellegrino, SFO/OPS

Cynthia Wimberly, SFO/Legal

David Rast, SFO/ENG

John Weckerle, SFO/ENG

613518

Submittal of Updated Reference Documents Cited in the Mixed Waste Landfill Long-Term Monitoring and Measurement Plan

Sandia National Laboratories Albuquerque, New Mexico EPA ID No. NM5890110518

CERTIFICATION STATEMENT

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision according to a system designed to ensure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine or imprisonment for knowing violations.

Michael W. Hazen, Vice Preside

Sandia Corporation

Albuquerque, New México

Operator

Date signed

James W. Todd, Assistant Manager

U.S. Department of Energy

National Nuclear Security Administration

Sandia Field Office (SFO)

Owner

Date signed

Enclosure A

Updated Reference Documents Cited in the Mixed Waste Landfill Long-Term Monitoring and Maintenance Plan for Sandia National Laboratories/New Mexico

February 2015

GROUNDWATER MONITORING WELL SAMPLING AND FIELD ANALYTICAL MEASUREMENTS FIELD OPERATING PROCEDURE

FOP 05-01 Revision 5

Tim Jackson, Subject Matter Expert,	te: 12/5/2014
Michael Skelly, Project Leader Date Date	te: 16 DEC/4
Don Schofield, Field Support Operations Project Leader Date of the Leader	te: 12/16/14
Pamela Puissant, Department Manager	te: 1/9/15
Author: How frequently does this document need to be reviewed and/or revised?	Every 3 years, or when activities change.
Manager: Does this document need to be tracked?	Yes
	1/03/15
	Tim Jackson, Subject Matter Expert Michael Skelly, Project Leader Dan Schofield, Field Support Operations Project Leader Pamela Puissant, Department Manager Author: How frequently does this document need to be reviewed and/or revised? Manager:

FOP 05-01 Rev. 5	

This page intentionally left blank.

TABLE OF CONTENTS

ACR	ONYMS & ABBREVIATIONS	VII
1.0	PURPOSE, SCOPE, AND OWNERSHIP	1
2.0	ROLES AND RESPONSIBILITIES	1
3.0	TRAINING QUALIFICATIONS	3
4.0	HEALTH AND SAFETY	
5.0	DEFINITIONS	
6.0	EQUIPMENT AND MATERIALS	7
7.0	PROCEDURE	
	7.1 Preparation	
	7.2 Documentation	
	7.3 Decontamination	
	7.4 Static Water Level Measurements	
	7.5 Well Evacuation (Purging)	
	7.5.1 Portable Non-Dedicated Piston Pump System	. 12
	7.5.2 Dedicated Low-Flow (Minimal Drawdown) Technique	
	7.6 Measuring Groundwater Field Parameter Data	
	7.7 Field Analysis	
	7.8 Sample Collection	
	7.8.1 Collection of Volatile Organic Analysis Fraction	
	7.8.2 Filtration for Dissolved Metals and Major Cation Fractions	
	7.8.3 Equipment Blanks, Field Blanks, and Duplicate (Split) Samples	
	7.8.4 Sample Handling and Documentation	
	7.9 Waste Disposal	
	7.10 Well Condition and Security	
	7.11 Sample Shipment	
	7.12 Quality Assurance	
8.0	RECORDS	
9.0	REFERENCES	
LIS	T OF TABLES e 3.1. Training Course List	
	T OF ATTACHMENTS ACHMENT A. Examples of Sample Label and Sample Identification Numbers	. 19
	r - r - r - r - r - r - r - r - r - r -	

TABLE OF CONTENTS (concluded)

LIST OF FORMS

ARCOC - Sample Management Office - Analysis Request and Chain of Custody Form

EP 2009-ALW - Environmental Planning - Activity Level Work Evaluation Form

EP 2009-AUL - Environmental Planning - Authorized Users List

EP 2009-OJT - Environmental Planning - On-the-Job Training

<u>EP 2009-WRA</u> – Environmental Planning – <u>Work Resumption Authorization Form</u>

<u>LTS GW-2012-001</u> – Field Measurement Log for Groundwater Sample Collection

LTS GW-2012-006 - Tailgate Safety Meeting Form

LTS GW-2012-002 - Groundwater Sample Collection Field Equipment Check Log

Revision History

Revision	Effective Date	Summary of Changes	
1	10/10/2005	New document	
2	8/16/2007	Formatting changes. Updated section 2, Roles and Responsibilities; section 3, Training Qualifications; section 9, References.	
3	11/12/2009	Formatting changes. Added work planning and control information to section 4.0, Health & Safety. Updated section 3, Training Qualifications; section 9, References.	
4	1/24/2012	Formatting changes. Revision history changed from 2 years to 3 years. Removal of some forms (attachments) and replaced with hyperlinks to where the forms can be found. Updated section 3, Training Qualifications; section 9, References.	
5	1/23/2015	Author change. Updated sections 1, 3, and 4.	

ACRONYMS & ABBREVIATIONS

AOP administrative operating procedure

ARCOC analysis request and chain of custody

DI deionized

DO dissolved oxygen

FOP field operating procedure

gal/ft³ gallon(s)/cubic foot

ft foot/feet in inch(es)

LOP laboratory operating procedure

mL milliliter(s)
min minutes(s)

OJT on-the-job training

ORP oxidation/reduction potential

pH potential for hydrogen

PHS primary hazard screening

PLA plan

SAP sampling and analysis plan

SC specific conductance

SMO Sample Management Office

SNL/NM Sandia National Laboratories, New Mexico

THA task hazard analysis
TOC total organic carbon

VOC volatile organic compound

FOP	05-0	1
1	Rev	5

This page intentionally left blank.

1.0 PURPOSE, SCOPE, AND OWNERSHIP

Purpose

This field operating procedure (FOP) provides instruction on collecting a groundwater sample from a monitoring well that is representative of in situ groundwater conditions and is suitable for laboratory analysis. The sample must be conducted per regulatory requirements and established agency guidance to provide legally defensible analytical data for regulatory compliance.

Scope

The scope of this procedure is limited to well purging, field analytical measurements, and the collection of samples from monitoring wells as part of Sandia National Laboratories, New Mexico (SNL/NM) groundwater monitoring activities.

Ownership

The Long-Term Stewardship Department is responsible for development, approval, distribution, revision, and control of this document.

2.0 ROLES AND RESPONSIBILITIES

The **project leader** is responsible for the following:

- Reviewing and recommending approval of this procedure.
- Providing overall coordination and management of the project.
- Providing a sampling and analysis plan (SAP) that meets prescribed regulatory or programmatic requirements.
- Reviewing completed field forms and data pertaining to the sampling activities.
- Reporting all information as may be required by regulations or directives.

The **project coordinator** is responsible for the following:

- Generating a mini-SAP from the SAP. The mini-SAP is a field friendly version of the SAP. It details sampling activities for the field support operations project leader and field technicians. It summarizes sampling procedures, analytical parameters, field measured parameters, purge requirements, and waste management tasks. It also identifies monitoring well characteristics that may extend the sampling period (e.g., low yield wells, well construction issues, etc.).
- Coordinating sampling activities with the SNL/NM lead investigators, regulators, Kirtland Air Force Base and their environmental contractors, Sample Management Office (SMO), and field technicians.
- Providing the field support operations project leader with a copy of the mini-SAP.
- Coordinating sampling procedure variances with the project leader and the field support operations project leader.
- Reviewing completed field forms and data pertaining to the sampling activities.

- Ensuring that all data quality requirements are performed.
- Providing the project leader with a summary of field activities and sampling results.
- Reporting all information as may be required by regulations or directives.
- Submitting completed field forms to the Customer Funded Record Center and entry of relevant data to the Environmental Data Management System (EDMS) database.
- Managing, coordinating, and disposing of purge water and other waste generated from field operations in compliance with SNL/NM <u>Corporate Policy ESH100 Environment Safety & Health</u>, and <u>FOP 05-04</u>, *Groundwater Waste Management Plan*.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The field support operations project leader is responsible for the following:

- Ensuring that safety and quality assurance procedures are followed.
- Supervising the field technicians.
- Reviewing training requirements for field technicians.
- Providing for the on-the-job training (OJT) of new field technicians.
- Assigning field technicians (qualified by training and experience) to conduct the activities described in this procedure.
- Ensuring the materials and equipment necessary to perform the work are available.
- Maintenance of the training matrix for all field personnel.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The **field technician** is responsible for the following:

- Completing all necessary and required training as specified by the field support operations project leader.
- Maintaining and decontaminating equipment.
- Field checking instruments according to the manufacturer's instructions and this procedure.
- Purging the well in preparation for sample collection.
- Collecting and recording field measurements as required by this procedure and the mini-SAP
- Collecting, preserving, and storing samples as specified in the mini-SAP and in accordance with administrative operating plan (AOP) <u>AOP 95-16</u>, Sample Management and Custody.
- Delivering samples to SMO packaging and shipping facility within the required holding times
- Managing purge water and other generated waste.
- Securing wells.
- Informing the field support operations project leader of wells requiring maintenance or breach of well security.
- Completing and reviewing field documentation forms.

Providing recommendations for revisions to this procedure (if necessary).

3.0 TRAINING QUALIFICATIONS

Personnel conducting field activities shall complete the following:

- Read applicable sections of SNL/NM <u>Corporate Policy ESH100 Environment Safety & Health.</u>
- Read primary hazard screening (PHS) <u>SNL05A01241</u>, *Groundwater Monitoring Activities*.
- OJT for new field personnel performing groundwater sampling activities. Document training by completing <u>On-the-Job Training</u> form (<u>EP 2009-OJT</u>).
- Read and sign AOP 95-16, Sample Management and Custody.
- Read and sign <u>FOP 03-02</u>, Groundwater Level Data Acquisition and Management.
- Read and sign laboratory operating procedure (LOP) <u>LOP 94-03</u>, Sample Handling, Packaging and Shipping.
- Read and sign FOP 05-02, Groundwater Monitoring Equipment Field Check.
- Read and sign <u>FOP 05-03</u>, Groundwater Sampling Equipment Decontamination.
- Read and sign FOP 05-04, Groundwater Waste Management Plan.
- Read and sign Plan (PLA) PLA 05-09, Groundwater Monitoring Health & Safety Plan.
- Complete training courses listed in Table 3.1.
- Field personnel shall sign the <u>Authorized Users List</u> (<u>EP 2009-AUL</u>) to affirm they have read and understand this document, and agree to operate within the stated constraints.

Table 3.1. Training Course List

Course Code	Course Title
CHM100/103	Chemical Safety Training/Site-Specific Chemical Training
ENV100	OSHA Health & Safety Basic Training - General Worker (40 HR)
ENV103	OSHA Health & Safety Training Refresher (8 HR)
ENV112	Hazardous Waste & Environmental Management Training
ENV216	RCRA - Less Than 90-Day Area Accumulation Area for Owners &
	Emergency Coordinators
ENV316	RCRA - Less Than 90-Day Area Accumulation Area for Waste
	Workers
ENV416	RCRA - Less Than 90-Day Area Accumulation Area for Waste
	Workers - Site-Specific
ESH100	ES&H Awareness
FKL153	Forklift Operator and Hands-On Training
MCH200	Hand and Power Tool Safety
MED102	Standard First Aid
MED104	Heartsaver CPR
OTS101	Occupational Thermal Stress
PKX050	Site Specific Packaging and Transportation of Hazardous Materials
	Training
PKX100	Basic Hazardous Material Transportation Training
PPE106	Personal Protective Equipment Training
PRS150	Pressure Safety Orientation
PRS250	Advanced Pressure Safety
RAD230	Radiological Worker II Training

CPR = Cardiopulmonary Resuscitation

ES&H = Environment, Safety and Health

HR = hour

OSHA = Occupational Safety and Health Administration

RCRA = Resource Conservation and Recovery Act

4.0 HEALTH AND SAFETY

A task hazard analysis (THA) has been performed on the activities described in this FOP as well as a hazard assessment survey performed by a SNL/NM industrial hygienist. They are detailed in the <u>PLA 05-09</u>, *Groundwater Sampling Health and Safety Plan*. The THA was performed in conjunction with PHS <u>SNL05A01241</u>, *Groundwater Monitoring Activities*.

An <u>Activity Level Work Evaluation Form</u> (EP 2009-ALW) was completed and approved by the department manager as required by <u>AOP 09-10</u>, Work Planning and Control and documented in the groundwater program safety case (ALW 13-01).

A field technician or the field support operations project leader shall conduct a tailgate safety meeting and fill out a <u>Tailgate Safety Meeting Form</u> prior to the start of groundwater sampling activities as described in <u>PLA 05-09</u>, *Groundwater Sampling Health and Safety Plan*.

In the event that work is stopped due to:

- Safety-related issues,
- an injury incurred while performing the tasks identified in this procedure, or
- as the result of an audit,

the field technicians shall immediately notify the field support operations project leader, the project coordinator, the project leader, and the department manager. The field technicians shall seek the assistance of the field support operations project leader for the mitigation of the hazard and the completion of a <u>Work Resumption Authorization Form (EP 2009-WRA)</u> as required by <u>AOP 09-10</u>, *Work Planning and Control*. The department manager shall sign the completed form prior to the restart of work.

In the event that minor changes/deviations in field activities need to be addressed in this FOP or minor updates to the FOP need to be added prior to the official revision/review process, the Field Technician shall discuss the change/deviation with the Field Operations Support Program Lead and submit a Minor Change/Deviation to Technical Work Document (TWD) Form (EP 2009-MCD). The form is then reviewed and signed by the Field Operations Support Program Lead and the Department Manager. The "Minor Change/Deviation to Technical Work Document" form and any possible attachments are filed with the original document, and posted on the 4100 Controlled Documents website.

5.0 **DEFINITIONS**

analysis request and chain of custody (ARCOC) – Method for documenting the history and possession of a sample from the time of its collection, through its analysis and data reporting, to its final disposition.

decontamination – A process used to clean equipment.

dedicated sampling equipment - Sampling equipment that is installed for use in only one monitoring well to prevent potential cross-contamination between wells.

duplicate (or split) sample - A sample which is split into subsamples contemporaneous in time and space.

equipment blank – A sample collected from chemically pure water (reagent-grade deionized [DI] water) that is passed through an item of field sampling equipment and returned to the laboratory for analysis. It is used to determine the effectiveness of equipment decontamination process. This may also be referred to as a decontamination rinsate blank.

field blank – Chemically pure water (reagent-grade DI water) that is subjected to all aspects of sample collection, field processing, preservation, transportation, and laboratory handling as an environmental sample.

groundwater - Water beneath the land surface contained in interconnected pores or secondary openings in the saturated zone that is under hydrostatic pressure. The water that enters wells and issues from springs.

headspace - The empty volume in a sample container between the water level and the cap.

mini-SAP – A detailed document describing the location of wells to be sampled; the frequency of sampling; the analysis to be performed; purge volumes, sample containers, sample preservatives, and sample holding times; and the analytical methods to be utilized. The plan references procedures used to collect, handle, and analyze groundwater samples. It includes all quality control measures that will be implemented to ensure that all activities meet any prescribed regulatory or programmatic requirements.

monitoring well - A well that is constructed for the purpose of extracting groundwater for physical, chemical, or biological testing, or for measuring water levels.

preservation - Storage conditions or addition of a reagent that will minimize the change in concentration of a constituent of interest until analysis can be performed.

purge – The process of removing stagnant water from a well prior to sampling.

Sample Management Office (SMO) - A SNL/NM organization responsible for coordinating with analytical laboratories to have groundwater samples analyzed. SMO receives sample bottles from the laboratory and is responsible for shipping samples.

saturated casing volume - The volume of water contained in one length of the saturated screen casing plus the volume of water contained in the borehole annulus surrounding the outside of the screen casing interval.

static water level – The elevation of the top of a column of water in a monitoring well that is at equilibrium.

trip blank – Laboratory prepared samples of chemically pure water (reagent-grade DI water) used to assess volatile organic compound contamination of the sample container, laboratory preparation water, or contamination resulting from handling procedures. Trip blanks are prepared in the same type of bottle used for an environmental sample and is kept with the set of sample bottles both before and after sample collection.

volatile organic compounds (VOCs) – Liquids or solid organic compounds that exhibit a tendency to pass into the vapor state.

6.0 EQUIPMENT AND MATERIALS

Two pumping methods are used to collect groundwater samples. Each method uses an inert gas (nitrogen) to operate the pump. No aeration of the sample occurs because the sample is isolated from the driving gas. The pump methods are:

- 1. A piston pump (Bennett model 1800 or equivalent) is used to purge water from the well casing.
- 2. A pneumatic bladder pump is used for low-flow technique that uses a pneumatic bladder sampling pump. Only the discharge line from the pump must be purged.

The following list includes equipment and materials necessary to collect a sample, document its collection, and request the laboratory analyses. Not all of the equipment may be required for each sampling event. The list depends on the methods used for purging and sampling, and the potential presence of contaminants in groundwater at the site. Details are specified in the mini-SAP.

Consumables

- DI water.
- ➤ Decontamination supplies listed in <u>FOP 05-03</u> (detergents, DI water, reagent grade nitric acid, buckets, brushes, etc.). Additional decontamination requirements and supplies may be specified in the mini-SAP.
- > Small and large zip-lock and bubble wrap bags.
- Insulated ice chest (coolers), blue ice or ice.
- Duct tape.
- > Paper wipes.
- Wash bottles.
- Sample containers with the required reagents for field preservation of samples. They are identified in the mini-SAP and are provided by SMO and/or the laboratory. (Note:

Visually inspect preservatives for discoloration or degradation prior to use to ensure reagent quality.).

- > Seals (custody seal tape).
- > Indelible black ink pens.
- > Personal protective equipment. Reference PLA 05-09, Groundwater Sampling Health and Safety Plan.

Documentation Forms

- > Groundwater Sample Collection Field Equipment Check Log,
- Field Measurement Log for Groundwater Sample Collection
- Examples of Sample Label and Sample Identification Numbers (Attachment A).
- Analysis request and chain of custody (ARCOC).

Other Equipment

- > Portable Bennett piston pump system or equivalent.
- > Compressed nitrogen gas cylinders with associated regulators, calibrated pressure relief valves and high pressure air lines, as necessary, to operate portable Bennett piston pump system or equivalent.
- > Water level indicator.
- > Empty 55-gallon close head poly drums for purge water/decontamination fluids.
- > 0.45 micron membrane filter for filtering the dissolved metals.
- Equipment for groundwater field parameters (pH, specific conductivity [SC]. temperature, dissolved oxygen [DO], turbidity, oxidation/reduction potential [ORP]; calibration standards) as specified in FOP 05-02.
- > Equipment for field analysis water chemistry such as a digital titrator and colorimeter.

Additional Items

- > Calculator.
- > Location map of monitoring wells to be sampled.
- > Well construction details of monitoring wells to be sampled (depth from top of casing, casing diameters, screen length and depths).
- > Key to well lock(s) and for gate access to site (if applicable).
- > Equipment manuals.
- ➤ Tool box.
- ➤ 2-way radio.

7.0 PROCEDURE

7.1 Preparation

The field technician must complete the following prior to field operations:

- 1. Review the mini-SAP with the project coordinator and schedule the sampling dates.
- 2. Obtain the required information listed below:
 - a. Location of wells.
 - b. Depth of wells.
 - c. Diameter of well casings and other well construction data.
 - d. Method to be used to purge wells.
 - e. Methods used to sample wells.
 - f. Analytical parameters including number of equipment blanks, duplicate samples, trip blanks.
- 3. Coordinate site access with the appropriate organization.
- 4. Obtain the sample containers from SMO. Sample containers must be prepared with the appropriate preservatives by the laboratory or SMO prior to sampling.
- 5. Make provisions for proper storage and disposal of purge water, decontamination fluids, and other wastes generated during purging and sampling activities.
- 6. Obtain sample identification numbers from the SMO or field support operations project leader and prepare sample labels. Affix labels to sample bottles.
- 7. Complete as much as possible of the following forms prior to field operations:
 - a. Groundwater Sample Collection Field Equipment Check Log,
 - b. Field Measurement Log for Groundwater Sample Collection,
 - c. ARCOC,
- 8. Load and secure the equipment and supplies in the sampling vehicle.

7.2 Documentation

Document all sampling activities by completing the appropriate forms. Use a dark indelible ink pen. Make any necessary corrections by drawing a single line through the incorrect entry, initial and date it, and place the correct entry adjacent to the incorrect entry.

The documentation forms are briefly discussed below:

<u>Field Measurement Log for Groundwater Sample Collection</u>. This form is used to record the following:

- ➤ Water level depth
- > Purge volumes
- > Purge field parameters
- > Instrument calibration
- > Sample collection
- ➤ Well condition
- > Weather condition

Sample Label, (Attachment A). An adhesive-backed waterproof label is affixed to each sample container before sample collection. Complete the following entries on the label with a black waterproof ink pen:

- ➤ Sample ID #
- > Sample Type
- > Analysis
- > Location
- ➤ Date
- > Time
- > Preservative
- > Collector

See AOP 95-16 for more information on the sample label.

Sample Identification Number (Sample # / Sample ID), (Attachment A). A sample consists of groundwater collected at a specific location and time. A unique sample number and sample identification is assigned to each sample collected. The sample number is placed in the appropriate space of the Sample Label, and the <u>ARCOC</u> record.

An example of a Sample # is 001234-001 where the

- > 001234 References a unique sample identification number. This number is obtained by going to the <u>SMO Home</u> page and clicking the "Control Numbers" tab.
- > -001 A fraction that references an analysis. For example -001 for a VOC analysis, -017 for a major cations analysis, and -027 for a cyanide analysis.

An example of a Sample Identification # is MWL-MW1 where the

- ➤ MWL References the monitor well location.
- ➤ MW1 References the monitor well number.

See AOP 95-16 for more information on the Sample Identification Number.

Analysis Request and Chain-of-Custody Record (ARCOC). An original ARCOC record must accompany all samples from the field to the laboratory. The ARCOC provides a legal record of the sample from collection to disposal. The ARCOC also specifies the sample analysis. Instructions for completing the ARCOC are provided on the back of the form. ARCOC numbers are obtained at the SMO Home page and clicking the "Control Numbers" tab.

See AOP 95-16 for more information on the ARCOC.

7.3 Decontamination

Decontaminate all equipment used to sample groundwater prior to placement in a well. Follow the directions listed in <u>FOP 05-03</u> for decontaminating equipment.

7.4 Static Water Level Measurements

Water level information is used to calculate the volume of water in a well casing and the minimum amount required for purging. The static water level is measured in each well prior to purging or obtaining a sample. Static water level measurements are taken to the nearest 0.01 foot using a water level indicator. Measurements are referenced to a surveyed mark of known elevation at the top the well casing. See <u>FOP 03-02</u> for collecting a static water level measurement. (Note: Because the static water level measurement is used to calculate a purge volume it is not necessary to follow every step of <u>FOP 03-02</u>. Use it only as general guidance for obtaining a static water level measurement.)

7.5 Well Evacuation (Purging)

Purging a well removes stagnant water so that a representative sample of the groundwater can be obtained. Purging requirements are affected by one or more of the following and are detailed in the mini-SAP:

- Permit requirements
- The pump and sample method used (conventional vs. low-flow)
- Well construction
- Well recharge rate
- Equipment limitations

Purge the well at a rate that creates minimal disturbance to the groundwater flow regime. This ensures the most representative sample of the groundwater. Monitor the water level during the purging process to help indicate minimal disturbance. Purge the well until the volume specified in the mini-SAP is met and until groundwater field parameters stabilize. See section 7.6 for more information on measuring groundwater field parameters. Instructions for purging using the two different pump methods are listed in the next two sections.

7.5.1 Portable Non-Dedicated Piston Pump System

Install the pump according to its operating manual and criteria specified in the mini-SAP. The pump intake should be set at or near the bottom of a well's screened interval. Nitrogen gas is used to operate the pump. The flow rate is controlled by varying the gas pressure on the pump. A minimum of one saturated casing volume (unless otherwise specified in the mini-SAP) needs to be purged when using a portable non-dedicated piston pump system. A saturated casing volume is defined as the volume of one length of the saturated screen (VI) plus the borehole annulus surrounding the outside of the well screen interval (V3). The following formulas are used to calculate a saturated casing volume:

$$VI = RI^2 \times \pi \times (H2 - HI) \times 7.48$$
 gallon/cubic feet (gal/ft³)
 $V2 = R2^2 \times \pi \times (H2 - HI) \times 7.48$ gal/ft³
 $V3 = (V2 - VI) \times 0.30$

Minimum purge volume or saturated casing volume = V3 + V1

where:

$\pi = 3.14$
RI = radius of the well casing feet (ft) = [diameter of well casing inch (in) x 1(ft)/12 (in)]
/ 2
R2 = radius of borehole (ft) = [diameter of borehole (in) x 1 (ft)/12 (in)] / 2
V1 = volume of submerged screen length casing interval
V2 = volume of submerged screen length annulus
V3 = submerged annulus volume
H1 = depth to water in screen (ft) not to exceed length of screen
H2 = well depth (ft)
H2 - H1 = static water height (ft) in well screen
0.30 = filter pack porosity

Begin purging the well after the minimum purge volume has been determined. If possible, purge the well at a flow rate equal to the recharge rate of the well. A pumping rate that is equal to the recharge rate will keep the water level in the well constant. Otherwise, turn down the flow rate to the lowest level possible and still maintain flow at the surface. Record groundwater field parameters at a minimum of every 5 gallons. Groundwater field parameters must stabilize before

samples are collected. See Section 7.6 for more information on collecting groundwater field parameter data.

If the well goes dry during the purging process, allow the water in the well to recover to 80 percent of the static water level. If the recovery time exceeds 2 hours, collect the samples as soon as there is a sufficient volume.

7.5.2 Dedicated Low-Flow (Minimal Drawdown) Technique

The pump and its tubing were installed previously and are dedicated to the well. Nitrogen gas is used to operate the pump. The flow rate is controlled by varying the gas pressure on the pump. The flow rate is set to less than or equal to the recharge rate of the well.

A minimum of two tubing water volumes (unless otherwise specified in the mini-SAP) need to be purged when using the Dedicated Low-Flow technique. Calculate tubing water volumes using the following formula.

one tubing water volume = $\pi r^2 h * 28310$ milliliter (mL)/ft³

where:

```
\pi = 3.14
r = \text{radius of the sample tubing (ft)} = [\text{diameter of sample tubing (in)} \times 1(\text{ft})/12 \text{ (in)}] / 2
h = \text{tubing length (ft)}
```

The following formulas are provided on the "Field Measurement Log For Groundwater Collection" to calculate the volume of water in one tubing length.

Tubing Diameter

1/4"	outer diameter,	0.17"	inner diameter:	4.5 mL/ft X	(length of tubing in ft) =	_mL
3/8"	outer diameter.	0.25"	inner diameter:	9.6 mL/ft X	(length of tubing in ft) =	шL

Set the purge rate to less than or equal to the recharge rate of the well. A purge rate of < 1000 mL/minute (min) is desired. Monitor the water level periodically and adjust the purge rate to minimize drawdown in the well to less than 0.1 meters. It is especially important to minimize disturbance to the water in the well when measuring the water level. Record groundwater field parameters a minimum of four readings per tubing volume. Samples are collected after a minimum of two tubing water volumes are purged and the groundwater field parameters are stable. See Section 7.6 for more information on collecting groundwater field parameter data. (Note: Wait a minimum of 24 hours before sampling with a newly installed dedicated low-flow pump.)

7.6 Measuring Groundwater Field Parameter Data

Connect the flow-through cell to the pump tubing. The flow-through cell houses the probes used to measure most of the groundwater field parameters (pH, SC, temperature, ORP, DO). Water pumped from the well flows through the cell and contacts the probes. Turbidity is measured with a portable turbidimeter.

Groundwater field parameters are identified in the mini-SAP. All instruments and their corresponding probes are function checked prior to recording groundwater field parameters. Function check the instruments in accordance with FOP 05-02.

The samples are collected (see Section 7.8) after the well or tubing is properly purged and the groundwater field parameters are stable. The following stability criteria apply (if no others are listed in the mini-SAP):

Four consecutive measurements of:

- \rightarrow +/- 0.1 standard units for pH.
- > +/- 1.0 degrees Celsius for temperature.
- \rightarrow +/- 5 percent for SC.
- \rightarrow +/- 10 percent or \leq 5 nephelometric turbidity units for turbidity.

Additional field parameters may include ORP and DO, as required in the mini-SAP. Field measurements are recorded on the <u>Field Measurement Log for Groundwater Sample</u> Collection.

7.7 Field Analysis

Samples may be collected for field analysis such as alkalinity, hexavalent chromium, nitrate, and ferrous iron. The field analyses will be specified in the mini-SAP. Digital titrators and colorimeters are used to perform the field analyses. Follow the manufacturer's procedures when performing the analyses. Document the results on the <u>Field Measurement Log for Groundwater Collection</u> or specific field analysis forms if applicable.

7.8 Sample Collection

Sample wells in the order specified in the mini-SAP. If an order is not specified, sample wells in the order from least contaminated to most contaminated. This will minimize the potential for cross-contaminating wells. If the potential for groundwater contamination has not been established at the site, sample wells from the up gradient direction toward the down gradient direction.

After the purging criteria have been met and groundwater field parameters are stable, collect the samples specified in the mini-SAP. Collect samples in the order of decreasing volatilization sensitivity, as applicable:

Most Volatile:	 Volatile organic compounds Total organic halogens Total organic carbon (TOC) Base-neutral and acid extractable organic
	compounds
Least Volatile:	5. Total metals
	6. Dissolved metals
	7. Phenols
İ	8. Cyanide
	9. Sulfate and chloride
	10. Turbidity (for laboratory analysis)
	11. Nitrate and ammonia
	12. Radionuclides
	13. Bacteria

7.8.1 Collection of Volatile Organic Analysis Fraction

Collect the VOC samples at a slow discharge rate to minimize volatilization. VOC sample containers should be filled at a rate not exceeding 100 mL/min. The sampling system may be modified in order to split the flow of water, such that the flow can be reduce to a rate of 100 ml/min or less.

Fill the sample vial completely. Pour the last few drops into the vial so that surface tension forms a convex meniscus on the water surface in the vial. Cap the bottle securely. Slight overflow will result in the elimination of air space in the bottle. Turn the bottle over and tap it gently to check for bubbles. If bubbles are present, repeat the procedure using a new sample container.

7.8.2 Filtration for Dissolved Metals and Major Cation Fractions

Sample fractions for dissolved metals and major cations (potassium, calcium, sodium, magnesium) require filtration to remove suspended solids. Use a disposable 0.45- micron in-line filter. Place over the discharge outlet. A minimum of over 500 mL should be drawn through the filter before sampling. Please note, filtration of samples is not limited to dissolved metals and cations. Consult the mini-SAP as to when filtration is required.

7.8.3 Equipment Blanks, Field Blanks, and Duplicate (Split) Samples

Collect any equipment blanks, field blanks, duplicate, or split samples as specified in the mini-SAP.

When collecting duplicate or split samples, it is important to take them in a consecutive order. That is, take all the VOC samples, then all the TOC samples, then all the metals, etc. Do not pull one complete set of samples and then pull another complete set. The groundwater chemistry may change during sampling and that could affect the consistency of the sample results.

7.8.4 Sample Handling and Documentation

Mark sample labels with the date and time of collection. Seal the sample containers with custody seal tape so they cannot be opened without breaking the tape. Place the sample containers inside sealable plastic bags. Immediately place samples requiring preservation into a sample cooler with ice or blue ice. Complete an <u>ARCOC</u> and transport the samples to SMO (see Section 7.11) when all field activities at the well location are completed.

7.9 Waste Disposal

Containerize, label, and process all wastes generated during purging, sampling, and decontamination activities in accordance with FOP 05-04.

7.10 Well Condition and Security

Remove all non-dedicated sampling equipment from the well and secure the equipment for transport. Place the casing cap on the well. Secure and lock the outer protective casing cap. Clean up the sampling site. Note on the <u>Field Measurement Log for Groundwater Sample Collection</u> any problems with the well (such as missing or damaged hasps, locks, concrete pads, protective posts, obstruction inside the well casings, well access, etc.). Immediately inform the field support operations project leader of the problem.

7.11 Sample Shipment

SMO personnel verify with the field technician that the sample labels and the <u>ARCOC</u> are filled out correctly before they take custody of the samples from the field technician. SMO is responsible for shipping the samples to the designated analytical laboratory within the required holding times. For further information on sample handling refer to <u>AOP 95-16</u>.

7.12 Quality Assurance

<u>FOP 05-02</u> is used as the quality assurance mechanism for operations described in this procedure.

8.0 RECORDS

A record of purging and sample collection activities is required. Forms that provide the required documentation are listed below:

- Field Measurement Log for Groundwater Sample Collection
- Examples of Sample Label and Sample Identification Numbers (Attachment A).
- ARCOC.
- Groundwater Sample Collection Field Equipment Check Log

The completed documentation is reviewed by the field support operations project leader. SMO will review sample labels and the <u>ARCOC</u> upon delivery of samples to the facility. All of the original documentation with the exception of the <u>ARCOC</u> and sample labels are provided to the project coordinator for review before submittal to the project leader. The project leader reviews, approves, and returns the documentation to the project coordinator for transmittal to the Customer Funded Record Center.

9.0 REFERENCES

Barcelona, J. J. A. Helfrich, E. E. Garske, and J. P. Gibb, 1984, "A Laboratory Evaluation of Groundwater Sampling Mechanisms," Groundwater Monitoring Review, Spring 1984, 32-41.

Bennett, Robert and Company, 1988, "Operation Manual for the Bennett Sampling Pump," Amarillo, Texas.

<u>HACH Company</u>, CAT. NO. 48470-22, Colorimeter, Model DR/890, Colorimeter Procedures Manual.

HACH Company, CAT. NO. 16900-08, Digital Titrator, Model 16900, Manual.

HACH Company, CAT. NO. 23145, Alkalinity Test Kit, Model AL-TA, Manual.

Nielsen, David M., and Gillian L. Yeates, 1985, "A Comparison of Sampling Mechanisms Available for Small-Diameter Groundwater Monitoring Wells," <u>Groundwater Monitoring</u> Review, Spring 1985, 83-99.

Sandia National Laboratories, <u>Corporate Policy ESH100 Environment Safety & Health</u>, SNL/NM.

Sandia National Laboratories, Sample Management Office, <u>LOP 94-03</u>, Sample Handling, Packaging and Shipping (latest edition), SNL/NM.

Sandia National Laboratories, Sample Management Office, <u>AOP 95-16</u>, Sample Management and Custody (latest edition), SNL/NM.

Sandia National Laboratories, Environmental Programs and Assurance Department, <u>FOP 03-02</u>, Long Term Environmental Stewardship Water Level Data Acquisition and Management (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-02</u>, *Groundwater Monitoring Equipment Field Check for Water Quality Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-03</u>, *Groundwater Monitoring Equipment Decontamination* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-04</u>, *Groundwater Monitoring Waste Management* (latest edition), SNL/NM.

Sandia National Laboratories, Environmental Programs and Assurance Department, PHS <u>SNL05A01241</u>, Long Term Environmental Stewardship Groundwater Monitoring Activities (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>PLA 05-09</u>, *Groundwater Monitoring Health and Safety Plan* (latest edition), SNL/NM.

ATTACHMENT A

EXAMPLES OF SAMPLE LABEL AND SAMPLE IDENTIFICATION NUMBERS

EXAMPLES OF SAMPLE LABEL AND SAMPLE IDENTIFICATION NUMBERS

Sandia National Laboratories	SNL/NM 018562
Environmental Programs	SNL/NM 018563
* ID.#	i
ANALYSIS	SNL/NM 018564
ATION	CNII /NINA O40EGE
TIME	SNL/NM 018565
RVATIVES	SNL/NM 018566
TOR	
1-94)	SNL/NM 018567
	SNL/NM 018568

GROUNDWATER MONITORING EQUIPMENT FIELD CHECK FOR WATER QUALITY MEASUREMENTS FIELD OPERATING PROCEDURE

FOP 05-02 Revision 5

Author:	Tim Jackson, Subject Matter Expert	Date: 12/5/2014
Approved:	Michael Skelly, Project Leader	Date: 16DEC14
Approved:	Don Schofield, Field Support Operations Project Leader	Date: 12/16/14
Approved:	Pamela Puissant, Department Manager	Date: 1/9/15
	Author: How frequently does this document need to be reviewed and/or revised?	Every 3 years, or when activities change.
	Manager:	

Does this document need to be tracked?

EFFECTIVE DATE:

1/23/15

rements	FOP 05-02 Rev. 5
ık.	

TABLE OF CONTENTS

ACR	ONYMS & ABBREVIATIONS V	
1.0	PURPOSE, SCOPE, AND OWNERSHIP	. 1
2.0	ROLES AND RESPONSIBILITIES	
3.0	TRAINING QUALIFICATIONS	. 3
4.0	HEALTH AND SAFETY	
5.0	DEFINITIONS	. 5
6.0	EQUIPMENT AND MATERIALS	. 6
7.0	PROCEDURES	. 7
	7.1 Equipment Calibration and Function Check	. 7
	7.1.1 EXO Sonde and Handheld Display	
	7.1.2 HACH 2100Q Turbidimeter	
	7.2 Equipment Maintenance	. 9
8.0	RECORDS	. 9
9.0	REFERENCES	
LIS	T OF TABLES	
Tabl	e 3.1. Training Course List	. 4

LIST OF FORMS

EP 2009-ALW – Environmental Planning – Activity Level Work Evaluation Form
EP 2009-AUL – Environmental Planning – Authorized Users List
EP 2009-OJT – Environmental Planning – On-the-Job Training
EP 2009-WRA – Environmental Planning – Work Resumption Authorization Form
LTS GW-2012-002 – Groundwater Sample Collection Field Equipment Check Log
LTS GW-2012-006 – Tailgate Safety Meeting Form

FOP 05- Rev

Revision History

Revision	Effective Date	Summary of Changes	
Area area area area			
1	10/10/2005	New document	
2	8/16/2007	Formatting changes. Updated section 2, Roles and Responsibilities; section 3, Training Qualifications; section 9, References.	
3	11/12/2009	Formatting changes. Added work planning and control information to section 4.0, Health & Safety. Updated section 3, Training Qualifications; section 9, References.	
4	1/24/2012	Formatting changes. Revision history changed from 2 years to 3 years. Removal of some forms (attachments) and replaced with hyperlinks to where the forms can be found. Updated section 3, Training Qualifications; section 9, References.	
5	1/23/2015	Author change. Updates to all sections.	

ACRONYMS & ABBREVIATIONS

AOP administrative operating procedure

°C degrees Celsius

DO dissolved oxygen

ES&H Environmental, Safety & Health

FOP field operating procedure

LTS Long-Term Stewardship

mV millivolt

NTU nephelometric turbidity units

ORP oxidation/reduction potential

pH potential of hydrogen

PHS primary hazard screening

PLA plan

SAP sampling and analysis plan

SC specific conductivity

SNL/NM Sandia National Laboratories, New Mexico

THA task hazard analysis

Groundwater Monitoring Equipment Field Check for Water Quality Measurements January 2015	FOP 05-02 Rev. 5
This page intentionally left blank.	

1.0 PURPOSE, SCOPE, AND OWNERSHIP

Purpose

This field operating procedure (FOP) provides guidance on operating instruments used to measure groundwater field parameters during groundwater sampling of monitoring wells. Analytical parameters may include potential of hydrogen (pH), specific conductivity (SC), temperature, oxidation/reduction potential (ORP), turbidity, and dissolved oxygen (DO) content. The procedure also provides information on function checks and calibrations of instruments that act as the quality assurance mechanism for FOP 05-01, Groundwater Monitoring Well Sampling and Field Analytical Measurements.

Scope

This procedure applies to groundwater field parameters measured during groundwater sampling activities conducted at Sandia National Laboratories, New Mexico (SNL/NM).

Ownership

The Long-Term Stewardship Department is responsible for development, approval, and revision of this document.

2.0 ROLES AND RESPONSIBILITIES

The **project leader** is responsible for the following:

- Reviewing and recommending approval of this procedure.
- Providing overall coordination and management of the project.
- Providing a sampling and analysis plan (SAP) that meets prescribed regulatory or programmatic requirements.
- Reviewing completed field forms and data pertaining to the sampling activities.
- Reporting all information as may be required by regulations or directives.

The **project coordinator** is responsible for the following:

- Generating a mini-SAP from the SAP. The mini-SAP is a field friendly version of the SAP. It details sampling activities for the field support operations project leader and field technicians. It summarizes sampling procedures, analytical parameters, field measured parameters, purge requirements, and waste management tasks. It also identifies monitoring well characteristics that may extend the sampling period (e.g., low yield wells, well construction issues, etc.).
- Coordinating sampling activities with the SNL/NM lead investigators, regulators, Kirtland Air Force Base and their environmental contractors, Sample Management Office (SMO), and field technicians.

- Providing the field support operations project leader with a copy of the mini-SAP.
- Coordinating sampling procedure variances with the project leader and the field support operations project leader.
- Reviewing completed field forms and data pertaining to the sampling activities.
- Ensuring that all data quality requirements are performed.
- Providing the project leader with a summary of field activities and sampling results.
- Reporting all information as may be required by regulations or directives.
- Submitting completed field forms to the Customer Funded Record Center and entry of relevant data to the Environmental Data Management System database.
- Managing, coordinating, and disposing of purge water and other waste generated from field operations in compliance with SNL/NM <u>Corporate Policy ESH100 Environment Safety & Health</u>, and <u>FOP 05-04</u>, *Groundwater Waste Management Plan*.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The **field support operations project leader** is responsible for the following:

- Ensuring that safety and quality assurance procedures are followed.
- Supervising the field technicians.
- Reviewing training requirements for field technicians.
- Providing for on-the-job training of new field technicians.
- Assigning field technicians (qualified by training and experience) to conduct the activities described in this procedure.
- Ensuring the materials and equipment necessary to perform the work are available.
- Maintenance of the training matrix for all field personnel.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The **field technician** is responsible for the following:

- Completing all necessary and required training as specified by the field support operations project leader.
- Maintaining and decontaminating equipment.
- Field checking instruments according to the manufacturer's instructions and this procedure.
- Completing and reviewing field documentation forms.
- Providing recommendations for revisions to this procedure (if necessary).

3.0 TRAINING QUALIFICATIONS

Personnel conducting field activities shall complete the following:

- Read applicable sections of SNL/NM <u>Corporate Policy ESH100 Environment Safety & Health.</u>
- Read primary hazard screening (PHS) <u>SNL05A01241</u>, Groundwater Monitoring Activities.
- OJT for new field personnel performing field checks of water quality measurement equipment. Document training by completing On-the-Job Training form (EP 2009-OJT).
- Read and sign <u>FOP 03-02</u>, Groundwater Level Data Acquisition and Management.
- Read and sign <u>FOP 05-01</u>, Groundwater Monitoring Well Sampling and Field Analytical Measurements.
- Read and sign <u>FOP 05-03</u>, Groundwater Sampling Equipment Decontamination.
- Read and sign FOP 05-04, Groundwater Waste Management Plan.
- Read and sign plan (PLA) PLA 05-09, Groundwater Monitoring Health & Safety Plan.
- Complete training courses listed in Table 3.1.
- Field personnel shall sign the <u>Authorized Users List</u> (<u>EP 2009-AUL</u>) to affirm they have read and understand this document, and agree to operate within the stated constraints.

Table 3.1. Training Course List

Course Code	Course Title
CHM100/103	Chemical Safety Training/Site-Specific Chemical Training
ENV100	OSHA Health & Safety Basic Training - General Worker (40 HR)
ENV103	OSHA Health & Safety Training Refresher (8 HR)
ENV112	Hazardous Waste & Environmental Management Training
ENV216	RCRA - Less Than 90-Day Area Accumulation Area for Owners &
	Emergency Coordinators
ENV316	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers
ENV416	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers -
	Site-Specific
ESH100	ES&H Awareness
FKL153	Forklift Operator and Hands-On Training
MCH200	Hand and Power Tool Safety
MED102	Standard First Aid
MED104	Heartsaver CPR
OTS101	Occupational Thermal Stress
PKX050	Site Specific Packaging and Transportation of Hazardous Materials
	Training
PKX100	Basic Hazardous Material Transportation Training
PPE106	Personal Protective Equipment Training
PRS150	Pressure Safety Orientation
PRS250	Advanced Pressure Safety
RAD230	Radiological Worker II Training

NOTES: CPR = Cardiopulmonary Resuscitation ES&H = Environment, Safety and Health

HR = hour

OSHA = Occupational Safety and Health Administration RCRA = Resource Conservation and Recovery Act

HEALTH AND SAFETY 4.0

A task hazard analysis (THA) has been performed on the activities described in this FOP as well as a hazard assessment survey performed by a SNL/NM industrial hygienist. They are detailed in the PLA 05-09, Groundwater Monitoring Health & Safety Plan. The THA was performed in conjunction with PHS SNL05A01241, Groundwater Monitoring Activities.

An Activity Level Work Evaluation Form (EP 2009-ALW) was completed and approved by the department manager as required by administrative operating plan (AOP) AOP 09-10, Work Planning and Control and documented in the groundwater program safety case ALW 13-01.

A field technician or the field support operations project leader shall conduct a tailgate safety meeting and fill out a Tailgate Safety Meeting Form prior to the start of groundwater sampling activities as described in PLA 05-09, Groundwater Monitoring Health & Safety Plan.

In the event that work is stopped due to:

- Safety-related issues,
- an injury incurred while performing the tasks identified in this procedure, or
- as the result of an audit,

the field technicians shall immediately notify the field support operations project leader, the project leader, the project coordinator, and the department manager. The field technicians shall seek the assistance of the field support operations project leader for the mitigation of the hazard and the completion of a Work Resumption Authorization Form (EP 2009-WRA) as required by AOP 09-10, Work Planning and Control. The department manager shall sign the completed form prior to the restart of work.

In the event that minor changes/deviations in field activities need to be addressed in this FOP or Revisions to the FOP need to be added prior to the official revision/review process, the Field Technician shall discuss the change/deviation with the Field Operations Support Program Lead, and submit a Minor Change/Deviation to Technical Work Document Form (EP 2009-MCD). The form is reviewed and signed by the Field Operations Support Program Lead and Department Manager. The "Minor Change/Deviation to Technical Work Document" form and any possible attachments are filed with the original document, and posted on the 4100 Controlled Documents website.

5.0 **DEFINITIONS**

dissolved oxygen (DO) content - The DO content of the water in milligrams per liter (mg/L) or percentage of oxygen saturation of the water at the indicated temperature.

specific conductivity (SC) – The ability of a cubic centimeter of water to conduct electricity. It varies directly with the amount of ionic substances in the water and is measured in micro-mhos per centimeter (μmhos/cm) at 25°C. SC is an indirect measure of total dissolved solids in dilute solutions.

potential of hydrogen (pH) – The inverse log of the hydrogen ion concentration of a solution. A measure of the intensity for the basic or acidic condition of a solution. Range is from 0 to 14 with 1 being the most acidic. A neutral solution is at a pH of 7. Greater than 7 is considered basic.

oxidation/reduction potential (ORP) – The electric potential (usually measured in millivolts [mV]) required for the transfer of an electron from one molecule or element (the oxidant) to another molecule or element (the reductant). Used as a qualitative measure of the oxidation state of the molecules or compounds in solution.

temperature (°C) – The temperature of the water in degrees Celsius (°C).

turbidity (nephelo-metric) – The cloudiness in water due to suspended and colloidal organic and inorganic material. Water turbidity is measured in nephelometric turbidity units (NTUs).

6.0 EQUIPMENT AND MATERIALS

The following instruments are used to measure groundwater parameters:

- > YSI Model EXO Handheld Display with YSI EXO1 Sonde and flow-through cell to measure °C, pH, SC, DO, and ORP.
- ➤ HACH 2100Q Turbidity Meter.

Equivalent instruments may be substituted. Follow manufacturer's instructions for calibration and operation.

The following list includes field documentation forms, equipment and materials necessary to calibrate/check field analytical equipment, and/or to measure the parameters.

Documentation Forms:

➤ Groundwater Sample Collection Field Equipment Check Log

Calibration Standard Solutions – Calibration standard solutions must be factory supplied and have expiration dates and/or lot number on the container.

> pH solutions.

- > electrical conductivity solutions: measured in micromhos/centimeter (μmhos/cm) at 25°C reference solution.
- > standard for oxidation/reduction potential: measured in mV @ 25° C.
- ➤ Gelex[®] or equivalent turbidity standards: \leq 10, 20, 100, and 800 NTU.

Additional Items:

- > manufacturer's instructions/operator/manuals
- > deionized water (DI)
- > material safety data sheets

7.0 **PROCEDURES**

7.1 Equipment Calibration and Function Check

Review the mini-SAP to determine the groundwater field parameters to be measured and the corresponding instruments needed.

Calibrate or perform a function check on the instruments prior to measuring groundwater field parameters. Complete the Groundwater Sample Collection Field Equipment Check Log. Note the condition and quality of calibration standards. Make sure they have not exceeded their expiration date. Replace if necessary.

7.1.1 EXO Sonde and Handheld Display

The EXO sensors (except temperature) require periodic calibration, and procedures follow the same basic steps with slight variation. The following is a set of instructions for calibrating an EXO1 Sonde using a EXO Handheld Display. All calibrations should be conducted in a temperature controlled space. For additional information reference the manufacturer's manuals.

- 1) Turn unit on by pressing the green power button.
- 2) Go to the Calibrate menu.
- 3) Select the sensor and parameter to calibrate.
- 4) In the next menu, select a 1-, 2-, or 3-point calibration (depending on sensor type).
- 5) Click the Start Calibration button:
 - Initial data reported will be unstable and then move to stable readings.
 - Click graph data button to compare pre-calibration and post calibration values.
 - Once readings are stable, click Apply to accept calibration point.
- 6) Repeat the process for each sensor and calibration point.
- 7) Click Complete when all points have been calibrated.

No calibration is required for the temperature.

If a calibration error appears, then repeat the calibration procedure. Reference the manufacturer's manual for additional calibration procedures or if errors continue to occur during the calibration process. It may be necessary to replace a probe that cannot be calibrated.

7.1.2 HACH 2100Q Turbidimeter

The HACH 2100Q Turbidimeter should be calibrated every 3 months using StablCal Stabilized Formazin Standards followed by assigning values to Gelex® Secondary Turbidity Standards. Refer to the "Instrument and Procedure Manual" to perform this operation.

Once a value has been assigned to the Gelex® Secondary Turbidity Standards they can be used to perform a daily function check on the instrument prior to groundwater sampling activities. The following is a set of instructions to perform a function check prior to groundwater sampling activities:

- 1) Wipe the Gelex[®] Secondary Turbidity Standard cells (≤10, 20, 100, and 800 NTU) with a soft, lint-free cloth.
- 2) Apply a thin film of silicone oil and wipe with a soft cloth to obtain an even film over the entire surface of the cell.
- 3) Press: "I/O". The instrument will turn on. Place the instrument on a flat, sturdy surface.
- 4) Insert the Gelex® Secondary Turbidity Standard cell in the instrument cell compartment so the diamond or orientation mark aligns with the raised orientation mark in front of the cell compartment. Close the lid.
- 5) Select manual or automatic range selection by pressing the "RANGE" key. The display will show "AUTO RNG" when the instrument is in automatic range selection.
- 6) Select signal averaging mode by pressing the "SIGNAL AVERAGE" key. The display will show "SIG AV" when the instrument is using signal averaging. Use signal average mode.
- 7) Press: "**READ**". The display will show "----**NTU**", then the turbidity in NTU. Record the value after the lamp symbol turns off.

If the reading is not within 5% of the previously established value, recalibrate the instrument with StablCal Stabilized Formazin Primary Standards as indicated in the "Instrument and Procedure Manual".

To obtain a turbidity value on a groundwater sample, fill an empty cell, wipe with a soft lint-free cloth, and repeat steps 2 through 7.

7.2 Equipment Maintenance

Store the equipment and perform routine maintenance as required by the manufacturer's instructions.

8.0 RECORDS

The completed documentation is reviewed by the field technician and project coordinator before it is provided to the project leader. The project leader reviews, approves, and transmits the documentation to the Customer Funded Records Center.

9.0 REFERENCES

HACH Company, CAT. NO. 46500-88, Portable Turbidimeter, Model 2100P, Instrument and Procedure Manual.

Sandia National Laboratories, Corporate Policy ESH100 Environment Safety & Health, SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 03-02</u>, *Water Level Data Acquisition and Management* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-01</u>, *Groundwater Monitoring Well Sampling and Field Analytical Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-03</u>, *Groundwater Monitoring Equipment Decontamination* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-04</u>, *Groundwater Monitoring Waste Management* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, PHS SNL05A01241, *Groundwater Monitoring Activities* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>PLA 05-09</u>, *Groundwater Monitoring Health and Safety Plan* (latest edition), SNL/NM.

EXO User Manual, Advance Water Quality Monitoring Platform

Groundwater Monitoring January 2015	Equipment Field Check for Water Quality Measurements	FOP 05-02 Rev. 5
Marriage very very very very very very very ver		
	This page intentionally left blank.	
IMPORTANT NOTICE:	A printed copy of this document may not be the document currently version is located on the Sandia Restricted Network (SRN), 4100 Co	nn effect. The official ntrolled Documents

GROUNDWATER MONITORING EQUIPMENT DECONTAMINATION

FIELD OPERATING PROCEDURE

FOP 05-03 Revision 5

Author:	Tim Jackson, Subject Matter Expert	Date: 12/5/2014
Approved:	Michael Skelly, Project Leader	Pate: 160EC/4
Approved:	Don Schofield, Field Support Operations Project Leader	Pate: 12/16/14
Approved:	Pamela Puissant, Department Manager	Pate: 1/9/15
	Author: How frequently does this document need to be reviewed and/or revised?	Every 3 years, or when activities change.
	Manager: Does this document need to be tracked?	Yes

EFFECTIVE DATE:

1/23/15

FOP	05-0)3
	Rev	5

TABLE OF CONTENTS

ACF	RONYMS & ABBREVIATIONS	VII
1.0	PURPOSE, SCOPE AND OWNERSHIP	1
2.0	ROLES AND RESPONSIBILITIES	
3.0	TRAINING QUALIFICATIONS	
4.0	HEALTH AND SAFETY	
5.0	EQUIPMENT AND MATERIALS	
6.0	PROCEDURES	
	6.1 Equipment Decontamination	
	6.2 Decontamination Waste	6
7.0	RECORDS	7
8.0	REFERENCES	
Tabl	le 3.1. Training Course List	3
LIS	T OF FORMS	
EP 2 EP 2	009-ALW – Environmental Planning – Activity Level Work Evaluation Form 009-AUL – Environmental Planning – Authorized Users List 009-OJT – Environmental Planning – On-the-Job Training	
	009-WRA – Environmental Planning – Work Resumption Authorization Form	
	GW-2012-004 – Groundwater Monitoring Waste Generation Log	
	GW-2012-006 – Tailgate Safety Meeting Form	
LIS	<u>GW-2012-003</u> – Portable Pump and Tubing / Water Level Indicator Decontamination Lo	og
	Form	

FOP	05-0)3
	Rev.	5

Revision History

Revision	Effective Date	Summary of Changes
1	10/10/2005	New document
2	8/16/2007	Formatting changes. Updated section 2, Roles and Responsibilities; section 3, Training Qualifications; section 8, References.
3	11/12/2009	Formatting changes. Added work planning and control information to section 4, Health and Safety. Updated section 3, Training Qualifications; section 8, References.
4	1/24/2012	Formatting changes. Revision history changed from 2 years to 3 years. Removal of some forms (attachments) and replaced with hyperlinks to where the forms can be found. Updated section 3, Training Qualifications; section 8, References.
5	1/23/2015	Author change. Updated sections 2, 3, 4, and 6.

ACRONYMS & ABBREVIATIONS

AOP administrative operating plan

CHPD closed head polyethylene drum

DI deionized

FOP field operating procedure

HNO₃ nitric acid

L liter

LTS Long-Term Stewardship

ml milliliter

OJT on-the-job training

PHS primary hazard screening

PLA plan

PPE personal protective equipment

SAP sampling and analysis plan

SNL/NM Sandia National Laboratories, New Mexico

THA task hazard analysis

Groundwater Monitoring Equipment Decontamination January 2015	FOP 05-03 Rev. 5
This page intentionally left blank.	

1.0 PURPOSE, SCOPE AND OWNERSHIP

Purpose This field operating procedure (FOP) provides instruction for

decontaminating groundwater sampling equipment.

Scope This procedure applies to all groundwater sampling equipment used

during groundwater sampling activities conducted at Sandia

National Laboratories/New Mexico (SNL/NM).

The Long-Term Stewardship Department is responsible for **Ownership**

development, approval, distribution, revision, and control of this

document.

2.0 ROLES AND RESPONSIBILITIES

The **project leader** is responsible for the following:

- Reviewing and recommending approval of this procedure.
- Providing overall coordination and management of the project.
- Providing a sampling and analysis plan (SAP) that meets prescribed regulatory or programmatic requirements.
- Reviewing completed field forms and data pertaining to the sampling activities.
- Reporting all information as may be required by regulations or directives.

The **project coordinator** is responsible for the following:

- Generating a mini-SAP from the SAP. The mini-SAP is a field friendly version of the SAP. It details sampling activities for the field support operations project leader and field technicians. It summarizes sampling procedures, analytical parameters, field measured parameters, purge requirements, and waste management tasks. It also identifies monitoring well characteristics that may extend the sampling period (e.g., low yield wells, well construction issues, etc.).
- Coordinating sampling activities with the SNL/NM lead investigators, regulators, Kirtland Air Force Base and their environmental contractors, Sample Management Office, and field technicians.
- Providing the field support operations project leader with a copy of the mini-SAP.
- Coordinating sampling procedure variances with the project leader and the field support operations project leader.
- Reviewing completed field forms and data pertaining to the sampling activities.
- Ensuring that all data quality requirements are performed.
- Providing the project leader with a summary of field activities and sampling results.

- Reporting all information as may be required by regulations or directives.
- Submitting completed field forms to the Customer Funded Record Center and entry of relevant data to the Environmental Data Management System database.
- Managing, coordinating, and disposing of purge water and other waste generated from field operations in compliance with SNL/NM Corporate Policy ESH100 Environment Safety & Health, and FOP 05-04, Groundwater Waste Management Plan.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The field support operations project leader is responsible for the following:

- Ensuring that safety and quality assurance procedures are followed.
- Supervising the field technicians.
- Reviewing training requirements for field technicians.
- Providing for the on-the-job training (OJT) of new field technicians.
- Assigning field technicians (qualified by training and experience) to conduct the activities described in this procedure.
- Ensuring the materials and equipment necessary to perform the work are available.
- Maintenance of the training matrix for all field personnel.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The field technicians are responsible for the following:

- Completing all necessary and required training as specified by the field support operations project leader.
- Maintaining and decontaminating equipment.
- Completing and reviewing field documentation forms.
- Providing recommendations for revisions to this procedure (if necessary).

3.0 TRAINING QUALIFICATIONS

Personnel conducting equipment decontamination shall complete the following:

- Read applicable sections of SNL/NM <u>Corporate Policy ESH100 Environment Safety & Health.</u>
- Read primary hazard screening (PHS) <u>SNL05A01241</u>, *Groundwater Monitoring Activities*.
- OJT for new field personnel performing field checks of water quality measurement equipment. Document training by completing On-the-Job Training form (EP 2009-OJT).
- Read and sign FOP 03-02, Groundwater Level Data Acquisition and Management.
- Read and sign <u>FOP 05-01</u>, Groundwater Monitoring Well Sampling and Field Analytical Measurements.

- Read and sign <u>FOP 05-02</u>, Groundwater Monitoring Equipment Field Check for Water Quality Measurements.
- Read and sign FOP 05-04, Groundwater Waste Management Plan.
- Read and sign <u>FOP 09-05</u>, Conducting Slug Test Using Data Logger & Pressure Transducer (only necessary if conducting slug test).
- Read and sign plan (PLA) <u>PLA 05-09</u>, Groundwater Monitoring Health & Safety Plan.
- Complete training courses listed in Table 1.
- Field personnel shall sign the <u>Authorized Users List</u> (<u>EP 2009-AUL</u>) to affirm they have read and understand this document, and agree to operate within the stated constraints.

Table 3.1. Training Course List

	·
Course Code	Course Title
CHM100/103	Chemical Safety Training/Site-Specific Chemical Training
ENV100	OSHA Health & Safety Basic Training - General Worker (40 HR)
ENV103	OSHA Health & Safety Training Refresher (8 HR)
ENV112	Hazardous Waste & Environmental Management Training
ENV216	RCRA - Less Than 90-Day Area Accumulation Area for Owners & Emergency Coordinators
ENV316	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers
ENV416	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers - Site-Specific
ESH100	ES&H Awareness
FKL153	Forklift Operator and Hands-On Training
MCH200	Hand and Power Tool Safety
MED102	Standard First Aid
MED104	Heartsaver CPR
OTS101	Occupational Thermal Stress
PKX050	Site Specific Packaging and Transportation of Hazardous Materials
	Training
PKX100	Basic Hazardous Material Transportation Training
PPE106	Personal Protective Equipment Training
PRS150	Pressure Safety Orientation
PRS250	Advanced Pressure Safety
RAD230	Radiological Worker II Training

NOTES: CPR = Cardiopulmonary Resuscitation

ES&H = Environment, Safety and Health

HR = hour

OSHA = Occupational Safety and Health Administration

RCRA = Resource Conservation and Recovery Act

4.0 HEALTH AND SAFETY

A task hazard analysis (THA) has been performed on the activities described in this FOP as well as a hazard assessment survey performed by a SNL/NM industrial hygienist. They are detailed in the <u>PLA 05-09</u>, *Groundwater Monitoring Health & Safety Plan*. The THA was performed in conjunction with PHS <u>SNL05A01241</u>, *Groundwater Monitoring Activities*. An <u>Activity Level Work Evaluation Form (EP 2009-ALW)</u> was completed and approved by the department manager as required by administrative operating plan (AOP) <u>AOP 09-10</u>, *Work Planning and Control and documented in the groundwater program safety case (ALW 13-01)*.

A field technician or the field support operations project leader shall conduct a tailgate safety meeting and fill out a <u>Tailgate Safety Meeting Form</u> prior to the start of groundwater sampling activities as described in <u>PLA 05-09</u>, *Groundwater Monitoring Health & Safety Plan*.

In the event that work is stopped due to:

- Safety-related issues,
- an injury incurred while performing the tasks identified in this procedure, or
- as the result of an audit,

the field technicians shall immediately notify the field support operations project leader, the project leader, the project coordinator, and the department manager. The field technicians shall seek the assistance of the field support operations project leader for the mitigation of the hazard and the completion of a Work Resumption Authorization Form (EP 2009-WRA) as required by AOP 09-10, Work Planning and Control. The department manager shall sign the completed form prior to the restart of work.

In the event that minor changes/deviations in field activities need to be addressed in this FOP or minor updates to the FOP need to be added prior to the official revision/review process, the Field Technician shall discuss the change/deviation with the Field Operations Support Program Lead and submit a Minor Change/Deviation to Technical Work Document (TWD) Form (EP 2009-MCD). The form is reviewed and signed by the Field Operations Support Program Lead and the Department Manager. The "Minor Change/Deviation to Technical Work Document" form and any possible attachments are filed with the original document, and posted on the 4100 Controlled Documents website.

5.0 EQUIPMENT AND MATERIALS

The following list includes equipment and materials necessary for decontaminating groundwater sampling equipment:

- > 55-gallon closed head polyethylene drum (CHPD)
- ➤ deionized (DI) water
- hand-held squirt bottles containing DI water
- > non-phosphate laboratory detergent (e.g., Liqui-Nox®)
- > hand-held squirt bottles containing non-phosphate laboratory detergent and tap water
- bottle brushes
- paper wipes
- plastic containers/buckets with lids
- personal protective equipment (PPE) nitrile or latex gloves, chemical safety goggles, safety boots
- > plastic garbage bags and waste storage containers
- Decontamination Log Form
- > Groundwater Monitoring Waste Generation Log
- > reagent grade nitric acid (HNO₃)

6.0 PROCEDURES

6.1 Equipment Decontamination

Wear the PPE specified in the <u>PLA 05-09</u>, *Groundwater Monitoring Health & Safety Plan*, when decontaminating equipment. The following is a list of groundwater monitoring equipment that needs to be decontaminated after each use and a set of instructions for performing the decontamination process:

• static water level indicator

- 1) Wipe the last three feet of cable and probe with a paper wipe wetted with a 0.1% (1 milliliter/liter [1 ml/L]) Liqui-Nox[®]/DI or distilled water solution.
- 2) Wipe the last three feet of cable and probe with a paper wipe wetted with deionized or distilled water.
- 3) Wipe the last three feet of cable and probe with a clean, dry paper wipe.

• portable non-dedicated piston pump system

Complete the following after the pump and its tubing have been removed from the well:

- Remove Sonde from the flow-through cell and rinse the probes (potential for hydrogen, specific conductance, dissolved oxygen, temperature, oxidation/reduction potential) with DI or distilled water.
- 2) Seal the opening on the flow-through cell with the cap.
- 3) Make sure all of the tubing used in purging and sampling remains connected to the pump and is included in the decontamination process (including the flow-through cell).

- 4) Pump the following solutions through the tubing in the order listed below: Collect solution discharge in a 55-gallon CHPD.
 - > 5 gallons of DI or distilled water mixed with 20 ml Liqui-Nox[®].
 - > 5 gallons of DI or distilled water.
 - > 5 gallons of DI or distilled water mixed with 20 ml reagent grade HNO₃.
 - ➤ 3 times 5 gallons of DI or distilled water for a total of 15 gallons
- 5) Rinse outside of pump tubing with DI or distilled water.
- 6) Complete Decontamination Log form
- 7) Complete a Groundwater Monitoring Waste Generation Log form

• Dedicated Low-Flow Pump System

The pump and tubing are dedicated to the well and are not removed for decontamination. However, the tubing that is connected from the well to the flow-through cell is decontaminated. Complete steps 1 through 4 and steps 6 through 7 listed above.

Pressure Transducer and Cable

- 1) Wipe the cable (portion immersed in the water) and pressure transducer with a paper wipe wetted with a 0.1% (1ml/L) Liqui-Nox® /deionized or distilled water solution.
- 2) Wipe the cable (portion immersed in the water) and pressure transducer with a paper wipe wetted with deionized or distilled water.
- 3) Wipe the cable (portion immersed in the water) and pressure transducer with a clean, dry paper wipe.

Borehole Camera System

- 1) Wipe the cable (portion immersed in the water) and pressure transducer with a paper wipe wetted with a 0.1% (1ml/L) Liqui-Nox® /deionized or distilled water solution.
- 2) Wipe the cable (portion immersed in the water) and pressure transducer with a paper wipe wetted with deionized or distilled water.
- 3) Wipe the cable (portion immersed in the water) and pressure transducer with a clean, dry paper wipe.

6.2 Decontamination Waste

Handle all decontamination waste according to <u>FOP 05-04</u>, *Groundwater Waste Management Plan*.

7.0 RECORDS

The completed documentation is reviewed by the field support operations project leader and project coordinator before it is provided to the project leader. The project leader reviews and approves the documentation for transmittal to the Customer Funded Record Center by the project coordinator.

8.0 REFERENCES

Sandia National Laboratories, <u>Corporate Policy ESH100 Environment Safety & Health</u>, SNL/NM.

Sandia National Laboratories, Environmental Programs and Assurance Department, <u>FOP 03-02</u>, Long Term Environmental Stewardship Water Level Data Acquisition and Management (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-01</u>, *Groundwater Monitoring Well Sampling and Field Analytical Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-02</u>, *Groundwater Monitoring Equipment Field Check for Water Quality Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-03</u>, *Groundwater Monitoring Equipment Decontamination* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-04</u>, *Groundwater Monitoring Waste Management* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, FOP 09-05, Conducting Slug Test Using Pressure Transducer and Data Logger (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, PHS <u>SNL05A01241</u>, *Groundwater Monitoring Activities* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>PLA 05-09</u>, *Groundwater Monitoring Health and Safety Plan* (latest edition), SNL/NM.

FOP	05	5-0	3
	Re	v	5

GROUNDWATER MONITORING WASTE MANAGEMENT

FIELD OPERATING PROCEDURE

FOP 05-04 Revision 5

ACVISION 3				
Author:	Tim Jackson, Subject Matter Expert	ate: 12/3/2014		
Approved:	Michael Skelly, Project Leader	ate: 16DEC/4		
Approved:	Don Schofield, Field Support Operations Project Leader	ate: 12/16/14		
Approved:	Pamela Puissant, Department Manager	ate: 1/9/15		
	Author: How frequently does this document need to be reviewed and/or revised?	Every 3 years, or when activities change.		
	Manager: Does this document need to be tracked?	Yes		
	Does this document need to be tracked?	1/02/15		

EFFECTIVE DATE:

TABLE OF CONTENTS

ACRONYMS & ABBREVIATIONS	VII			
1.0 PURPOSE, SCOPE, AND OWNERSHIP	1			
2.0 BACKGROUND	1			
3.0 ROLES AND RESPONSIBILITIES	1			
4.0 TRAINING QUALIFICATIONS				
5.0 HEALTH AND SAFETY				
6.0 DESCRIPTION OF ACTIVITIES				
7.0 REFERENCES				
LIST OF TABLES				
Table 4.1. Training Course List	4			
LIST OF FORMS				
<u>EP 2009-ALW</u> – Environmental Planning – <u>Activity Level Work Evaluation Form</u>				
EP 2009-AUL – Environmental Planning – Authorized Users List				
EP 2009-OJT – Environmental Planning – On-the-Job Training				
EP 2009-WRA – Environmental Planning – Work Resumption Authorization Form				
SA2001-MWA – Less Than 90-Day Hazardous or Mixed Waste Accumulation Unit Inspecti	ion			
Form				
<u>LTS GW-2012-005</u> — Work Request Form				
LTS GW-2012-004 - Groundwater Monitoring Waste Generation Log				

Revision History

Revision	Effective Date	Summary of Changes
1	10/10/2005	New document
2	8/16/2007	Formatting changes. Updated section 3, Roles and Responsibilities; section 4, Training Qualifications; section 7, References.
3	11/12/2009	Formatting changes. Added work planning and control information to section 5, Health and Safety. Updated section 4, Training Qualifications; section 7, References.
4	01/24/2012	Formatting changes. Revision history changed from 2 years to 3 years. Removal of some forms (attachments) and replaced with hyperlinks to where the forms can be found. Updated section 4, Training Qualifications; section 7, References.
5	01/23/2015	Author change and updates to all sections.

ACRONYMS & ABBREVIATIONS

AOP administrative operating plan

CHPD closed-head poly drum

decon decontamination

FOP field operating procedure

HWMF Hazardous Waste Management Facility

LTS Long-Term Stewardship

OJT on-the-job training

PHS primary hazard screening

PLA plan

PPE personal protective equipment

RCRA Resource Conservation and Recovery Act
RMWDR radioactive or mixed waste disposal request

RMWMF Radioactive and Mixed Waste Management Facility

SAP sampling and analysis plan

SNL/NM Sandia National Laboratories, New Mexico

THA task hazard analysis

WDDR waste description and disposal request

FOP 05-04 Rev. 5

This page intentionally left blank.

1.0 PURPOSE, SCOPE, AND OWNERSHIP

Purpose This field operating procedure (FOP) provides instruction on managing waste

generated during groundwater sampling activities. Waste is managed in compliance with Sandia National Laboratories, New Mexico (SNL/NM)

Corporate Policy ESH100 Environment Safety & Health.

Scope The scope of this procedure is limited to management of waste generated during

groundwater monitoring activities at SNL/NM sites, and include well purge waste water, equipment decontamination (decon) waste water, personnel protective equipment (PPE) waste (nitrile or latex gloves), plastic, and paper wipes. All other waste generated during groundwater monitoring activities will be managed

in accordance with Corporate Policy ESH100 Environment Safety & Health.

Ownership The Long-Term Stewardship (LTS) Department is responsible for development,

approval, distribution, revision, and control of this document.

2.0 BACKGROUND

Sandia conducts two types of groundwater surveillance monitoring at SNL/NM: (1) on a site-wide basis as part of the SNL/NM LTS Program's Groundwater Monitoring Program Groundwater Surveillance Task and (2) as site-specific groundwater monitoring at LTS/Environmental Restoration Operations sites with ongoing groundwater investigations. Separate requirements and site-specific monitoring plans will be developed and detailed upon regulatory approval of corrective measure evaluation, post-closure care provisions, long-term monitoring and maintenance plans, and other regulatory procedures.

Based upon historical results, groundwater sampling of monitoring wells is not expected to produce waste or contaminated materials requiring special handling or regulated disposal.

3.0 ROLES AND RESPONSIBILITIES

The **project leader** is responsible for the following:

- Reviewing and recommending approval of this procedure.
- Providing overall coordination and management of the project.
- Providing a sampling and analysis plan (SAP) that meets prescribed regulatory or programmatic requirements.
- Reviewing completed field forms and data pertaining to the waste management activities.
- Reporting all information as may be required by regulations or directives.

The **project coordinator** is responsible for the following:

- Generating a mini-SAP from the SAP. The mini-SAP is a field-friendly version of the SAP. It details sampling activities for the field support operations project leader and field technicians. It summarizes sampling procedures, analytical parameters, field measured parameters, purge requirements, and waste management tasks. It also identifies monitoring well characteristics that may extend the sampling period (e.g., low-yield wells, well construction issues, etc.).
- If needed, preparing a waste management plan for each sampling event.
- Providing the field support operations project leader with a copy of the mini-SAP.
- Coordinating waste management activities with the project leader and the field support operations project leader.
- Reviewing completed field forms and data pertaining to the sampling activities.
- Ensuring that all data quality requirements are performed.
- Reviewing all analytical data used for waste characterization.
- Obtaining waste determination from the environmental protection representative (non-hazardous, hazardous, and radioactive).
- Managing, coordinating, and disposing of purge water and other waste generated from field operations.
- Obtaining discharge permits for purge and decon water from the Waste Water Discharge project leader.
- Submitting disposal request to the appropriate department (Hazardous Waste Management Facility [HWMF], Radioactive and Mixed Waste Management Facility [RMWMF], Waste Water, and Solid Waste).
- Coordinating with the field support operations project leader for disposal and discharges (Work Request Form).
- Tracking and documenting each waste activity.
- Performing and documenting weekly inspections of Building 9925 Resource Conservation and Recovery Act (RCRA) Less Than 90-Day Waste Accumulation Area.
- Performing and documenting weekly inventory of all waste stored at Building 9925 waste accumulation areas.
- Performing monthly inspection of emergency equipment.
- Maintaining documentation for waste disposal activities.
- Submitting completed field forms to the Customer Funded Record Center and entry of relevant data to the Environmental Data Management System database.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The field support operations project leader is responsible for the following:

- Ensuring that safety and quality assurance procedures are followed.
- Supervising the field technicians.

- Verifying field technicians' compliance with RCRA waste accumulation area training requirements.
- Providing for on-the-job training (OJT) of new field technicians.
- Assigning field technicians (qualified by training and experience) to conduct the activities described in this procedure.
- Ensuring the materials and equipment necessary to perform the work are available.
- Maintenance of the training matrix for all field personnel.
- Owner/manager/emergency coordinator of building 9925 RCRA Less Than 90-Day Waste Accumulation Area.
- Reviewing and providing recommendations for revisions to this procedure (if necessary).

The **field technicians** are responsible for:

- Completing all necessary and required training as specified by the field support operations project leader.
- Maintaining and decontaminating equipment.
- Managing and disposing of waste as directed by completed Work Request Forms and the field support operations project leader.
- Completing and reviewing field documentation forms.
- Providing recommendations for revisions to this procedure (if necessary).

The waste water discharge project leader is responsible for reviewing analytical data results of purge and decon water if requested by the project coordinator.

The environmental protection representative is responsible for reviewing analytical data results of purge and decon water if requested by the project coordinator.

The **health physicist** is responsible for reviewing analytical data results of purge and decon water if requested by the project coordinator.

4.0 TRAINING QUALIFICATIONS

Personnel conducting field activities shall complete the following:

- Read applicable sections of SNL/NM Corporate Policy ESH100 Environmental Safety & Health.
- Read primary hazard screening (PHS) SNL05A01241, Groundwater Monitoring Activities.
- OJT for new field personnel performing waste management activities. Document training by completing On-the-Job Training form (EP 2009-OJT).
- Read and sign FOP 03-02, Groundwater Level Data Acquisition and Management.

- Read and sign <u>FOP 05-01</u>, *Groundwater Monitoring Well Sampling and Field Analytical Measurements*.
- Read and sign <u>FOP 05-02</u>, Groundwater Monitoring Equipment Field Check.
- Read and sign <u>FOP 05-03</u>, Groundwater Sampling Equipment Decontamination.
- Read and sign <u>FOP 09-05</u>, Conducting Slug Test Using Data Logger & Pressure Transducer (only necessary if conducting slug test).
- Read and sign Plan (PLA) PLA 05-09, Groundwater Monitoring Health & Safety Plan.
- Complete training courses listed in Table 4.1.
- Field personnel shall sign the <u>Authorized Users List</u> (<u>EP 2009-AUL</u>) to affirm they have read and understand this document, and agree to operate within the stated constraints.

Table 4.1. Training Course List

Course Code	Course Title		
CHM100/103	Chemical Safety Training/Site-Specific Chemical Training		
ENV100	OSHA Health & Safety Basic Training - General Worker (40 HR)		
ENV103	OSHA Health & Safety Training Refresher (8 HR)		
ENV112	Hazardous Waste & Environmental Management Training		
ENV216	RCRA - Less Than 90-Day Area Accumulation Area for Owners &		
	Emergency Coordinators		
ENV316	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers		
ENV416	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers -		
	Site-Specific		
ESH100	ES&H Awareness		
FKL153	Forklift Operator and Hands-On Training		
MCH200	Hand and Power Tool Safety		
MED102	Standard First Aid		
MED104	Heartsaver CPR		
OTS101	Occupational Thermal Stress		
PKX050	Site Specific Packaging and Transportation of Hazardous Materials		
	Training		
PKX100	Basic Hazardous Material Transportation Training		
PPE106	Personal Protective Equipment Training		
PRS150	Pressure Safety Orientation		
PRS250	Advanced Pressure Safety		
RAD230	Radiological Worker II Training		

NOTES: CPR = Cardiopulmonary Resuscitation

ES&H = Environment, Safety and Health

HR = hour

OSHA = Occupational Safety and Health Administration

RCRA = Resource Conservation and Recovery Act

5.0 HEALTH AND SAFETY

A task hazard analysis (THA) has been performed on the activities described in this FOP as well as a hazard assessment survey performed by a SNL/NM industrial hygienist. They are detailed in the <u>PLA 05-09</u>, *Groundwater Monitoring Health & Safety Plan*. The THA was performed in conjunction with PHS <u>SNL05A01241</u>, *Groundwater Monitoring Activities*.

An <u>Activity Level Work Evaluation Form (EP 2009-ALW)</u> was completed and approved by the department manager as required by administrative cooperating plan (AOP) <u>AOP 09-10</u>, *Work Planning and Control and documented in the groundwater program safety case (<u>ALW 13-01</u>).*

A field technician or the field support operations project leader shall conduct a tailgate safety meeting and fill out a <u>Tailgate Safety Meeting Form</u> prior to the start of groundwater sampling activities as described in <u>PLA 05-09</u>, *Groundwater Monitoring Health & Safety Plan*.

In the event that work is stopped due to:

- Safety-related issues,
- an injury incurred while performing the tasks identified in this procedure, or
- as the result of an audit,

the field technicians shall immediately notify the field support operations project leader, the project leader, the project coordinator, and the department manager. The field technicians shall seek the assistance of the field support operations project leader for the mitigation of the hazard and the completion of a Work Resumption Authorization Form (EP 2009-WRA) as required by AOP 09-10, Work Planning and Control. The department manager shall sign the completed form prior to the restart of work.

In the event that minor changes/deviations in field activities need to be addressed in this FOP or revisions to the FOP need to be added prior to the official revision/review process, the Field Technician shall discuss the change/deviation with the Field Operations Support Program Lead, and submit a Minor Change/Deviation to Technical Work Document Form (EP 2009-MCD). The form is reviewed and signed by the Field Operations Support Program Lead and Department Manager. The "Minor Change/Deviation to Technical Work Document" form and any possible attachments are filed with the original document, and posted on the 4100 Controlled Documents website.

6.0 DESCRIPTION OF ACTIVITIES

The following is a description of activities for managing waste specific to groundwater monitoring activities and the groundwater monitoring program.

The project coordinator prepares a mini-SAP that provides the field support operations project leader and field technicians with the information necessary for them to perform work and manage waste properly. The project coordinator may include additional sample analytical requirements that are not specified in the mini-SAP but are necessary to properly characterize the waste.

The field support operations project leader and field technicians use the information provided in the mini-SAP to perform the monitoring activities at the designated locations. The waste generated during monitoring activities may include purge water, decon water, PPE, disposable filters, paper wipes, and plastic. The mini-SAP identifies how the waste will be managed.

All purge water and decon water will be collected in separate 55-gallon closed-head poly drums (CHPDs). A label will be placed on each 55-gallon CHPD drum indicating the following:

- ➤ Initial Label Type (per Corporate Policy ESH100 Environmental Safety & Health)
- ➤ Container Identification # (site-date-sequence)
- Project Name
- Waste Matrix (purge water or decon water)
- > Accumulation Start Date
- > Waste Owner, Organization, and phone number

All solid waste will be placed in a plastic trash bag and waste receptacle. A label will be placed on the waste container indicating the following:

- > Initial Label Type (per Corporate Policy ESH100 Environmental Safety & Health)
- ➤ Container Identification # (site-date-sequence)
- > Project Name
- ➤ Waste Matrix (PPE, paper wipes, plastic)
- > Accumulation Start Date
- > Waste Owner, Organization, and phone number

The field technicians will complete a <u>Groundwater Monitoring Waste Generation Log</u> as the waste is produced at each sampling location. The <u>Groundwater Monitoring Waste Generation Log</u> will identify:

- ➤ Container Identification # (site-date-sequence)
- Project Name
- > Initial Label Type (per Corporate Policy ESH100 Environmental Safety & Health)
- ➤ Waste Matrix (purge water, decon water, PPE, paper wipes, plastic)
- ➤ Container Type/Volume
- ➤ Volume of Waste
- > Total Container Weight
- > Chain of custody (COC) #: Sample#-Fraction

- > Accumulation Start & Full Date
- > Date Waste is moved to an Accumulation Area
- Accumulation Area Name

The waste drums will be moved to the appropriate storage area at completion of sampling activities. All hazardous waste will be placed in a RCRA Less Than 90-Day Waste Accumulation Area. The waste drums labeled as containing non-hazardous waste will be kept at an area designated for non-hazardous waste.

The field support operations project leader is responsible for managing and processing all hazardous and non- hazardous waste once they are placed into the Building 9925 storage areas. Hazardous waste cannot exceed the 90-day hold time for a RCRA waste accumulation area. SNL/NM requirements and guidance for management of hazardous wastes at less than 90 -day Accumulation Areas are addressed in the Corporate Procedure: ESH100.2.ENV22 Manage Hazardous Waste at SNL/NM. If an alternate 90-day area is used, the field support operations project leader will coordinate with the owner of the alternate site to ensure all regulatory and SNL/NM requirements are met.

All waste generated during groundwater monitoring activities will be managed in accordance with Corporate Policy ESH100 Environment Safety & Health. Contact SNL/NM's Environmental Compliance Coordinators for assistance with compliance of applicable environmental laws and regulations regarding waste management.

- 1. Disposal methods for waste generated during groundwater monitoring activities include:
 - > Discharge wastewater to the sanitary sewer.
 - Disposal through the HWMF.
 - Disposal as regular solid waste.

Sanitary Sewer Discharge — All wastewater is discharged to the sanitary sewer in accordance with Albuquerque Bernalillo County Water Utility Authority requirements . A sanitary sewer discharge permit will be issued to the project coordinator by the waste water discharge project leader.

HWMF Disposal — Purge and/or decon water that does not meet sanitary sewer discharge requirements and hazardous solid waste must be disposed through the HWMF.

If waste must be disposed through the HWMF, then the project coordinator will fill out and submit a HWMF Waste Description and Disposal Request (WDDR) form. A copy of the laboratory analytical results (electronic or hard copy) must also be submitted to the HWMF.

If a permit was issued for discharge (sanitary sewer), then the project coordinator will submit a <u>Work Request Form</u> to the field support operations project leader to perform the discharge. The <u>Work Request Form</u> includes the following information:

- > Project Name.
- Discharge Permit #.
- Indicate where the water will be discharged (ground surface or sanitary sewer).
- Number of containers to be emptied.
- > Total volume of water to be discharged.
- > Container identification numbers.
- > Date of Discharge.
- > Who completed the discharge.

The field support operations project leader receives the <u>Work Request Form</u> from the project coordinator to discharge the purge and/or decon water. The field support operations project leader schedules a field technician to discharge the purge and/or decon water as indicated in the <u>Work Request Form</u>. The completed <u>Work Request Form</u> is returned to the project coordinator by the field support operations project leader.

2. To dispose of hazardous waste, the project coordinator must fill out a HWMF WDDR form. The form is accessible on-line at:

http://www-irn.sandia.gov/esh/hwmf prgrm/wddr.htm

The HWMF may request a data package on the waste in addition to the WDDR form.

3. To dispose of radioactive or mixed waste, the project coordinator must fill out a RMWMF Radioactive or Mixed Waste Disposal Request (RMWDR) form. The form is accessible on-line at:

https://info.sandia.gov/esh/esh center/Radioactive Waste/RegWaste dforms.htm

The RMWMF may request a data package on the waste in addition to the RMWDR form.

7.0 REFERENCES

Sandia National Laboratories, <u>Corporate Policy ESH100 Environment Safety & Health</u>, SNL/NM.

Sandia National Laboratories, Environmental Programs and Assurance Department, <u>FOP 03-02</u>, Long Term Environmental Stewardship Water Level Data Acquisition and Management (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-01</u>, *Groundwater Monitoring Well Sampling and Field Analytical Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-02</u>, *Groundwater Monitoring Equipment Field Check for Water Quality Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-03</u>, *Groundwater Monitoring Equipment Decontamination* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 09-05</u>, Conducting Slug Test Using Pressure Transducer and Data Logger (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, PHS <u>SNL05A01241</u>, *Groundwater Monitoring Activities* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>PLA 05-09</u>, *Groundwater Monitoring Health and Safety Plan* (latest edition), SNL/NM.

This page intentionally left blank.

GROUNDWATER MONITORING HEALTH AND SAFETY PLAN

PLA 05-09 Revision 06

Author:	Tim Jackson, Subject Matter Expert	Date: 12/5/2014
Approved:	Michael Skely, Project Leader	Date: <u> 6 DEC/4</u>
Approved:	Don Schofield, Field Support Operations Project Leader	Date: 12/16/14
Approved:	Pamela Puissant, Department Manager	Date: 1 9 15
	Author: How frequently does this document need to be reviewed and/or revised?	Every three years, or when activities change.
	Manager: Does this document need to be tracked?	Yes

EFFECTIVE DATE: 1/23/15

This page intentionally left blank

TABLE OF CONTENTS

ACR	ONYMS AND ABBREVIATIONS	VII
1.0	PURPOSE, GOALS AND OBJECTIVES	1
2.0	ROLES AND RESPONSIBILITIES	1
3.0	TRAINING QUALIFICATIONS	4
4.0	SCOPE OF WORK	
5.0	PERSONAL PROTECTIVE EQUIPMENT	5
6.0	TASK HAZARD ANALYSIS	6
7.0	WORK PRACTICES	
8.0	TAILGATE SAFETY MEETING	9
9.0	SHUTDOWN OF WORK ACTIVITIES	9
10.0	EMERGENCY RESPONSE PLAN	10
	10.1 Directions to Medical Facilities	11
11.0	REFERENCES	12
LIS	T OF TABLES	
Table	e 3.1. Training Course List	5
Table	e 6.1. Task Hazard Analysis	7
Table	e 10.1. Points of Emergency Telephone Numbers	11
LIS'	T OF ATTACHMENTS	
ATT	ACHMENT A. SNL Medical Facilities Location Map	13
LIS	T OF FORMS	
EP 2	009-ALW – Environmental Planning – Activity Level Work Evaluation Form	
EP 2	009-AUL - Environmental Planning - Authorized Users List	
EP 2	<u>009-OJT</u> – Environmental Planning – <u>On-the-Job Training</u>	
EP 2	009-WRA – Environmental Planning – Work Resumption Authorization Form	
<u>LTS</u>	GW-2012-006 - Tailgate Safety Meeting Form	
LTS	GW-2012-005 – Work Request Form	

This page intentionally left blank

Revision History

Revision	Effective Date	Summary of Changes
1	10/10/2005	New document
2	8/16/2007	Formatting changes. Updated section 2, Roles and Responsibilities; section 3, Training Qualifications; section 11, References.
3	3/4/2010	Formatting changes. Added work planning and control information to section 6, Task Hazard Analysis. Updated section 3, Training Qualifications; section 11, References.
4	1/24/2012	Formatting changes. Revision history changed from 2 years to 3 years. Removal of some forms (attachments) and replaced with hyperlinks to where the forms can be found. Updated section 3, Training Qualifications; section 11, References.
5 ,	6/16/2014	Revised Work Planning and Controls requirements per Engineered Safety Implementation and included Mixed Waste Landfill Long Term Monitoring and Maintenance Plan HASP reference.
6	1/23/2015	Update sections with current Work Planning and Controls reference, and consistency with other groundwater monitoring documents.

Groundwater Monitoring Health and Safety Plan January 2015	PLA 05-09 Rev. 06
This page intentionally left blank	

ACRONYMS AND ABBREVIATIONS

AOP administrative operating plan

EOC Emergency Operations Center

FOP field operating procedure

GMP Groundwater Monitoring Program

HASP health and safety plan

KAFB Kirtland Air Force Base

LOP laboratory operating procedure

LTS Long Term Stewardship

OJT on-the-job training

PHS primary hazard screening

PLA plan

PPE personal protective equipment

RCRA Resource Conservation and Recovery Act

SAP sampling and analysis plan

SNL/NM Sandia National Laboratories, New Mexico

SMO Sample Management Office

THA task hazard analysis

TWD technical work document

This page intentionally left blank

1.0 PURPOSE, GOALS AND OBJECTIVES

Sandia Corporation conducts general groundwater surveillance monitoring for the U.S. Department of Energy (DOE), National Nuclear Security Administration (NNSA) at Sandia National Laboratories, New Mexico (SNL/NM). Monitoring is performed on a site-wide basis as part of the Long-Term Stewardship (LTS) Program's Groundwater Monitoring Program (GMP). The GMP includes groundwater surveillance and site-specific groundwater monitoring at LTS/Environmental Restoration (ER) Operations (formerly ER Project) sites with ongoing groundwater investigations.

This health and safety plan (HASP) covers groundwater monitoring operations that are detailed in associated regulations, requirements, and technical work documents (TWD) (i.e., administrative operating procedures [AOP], field operating procedures [FOPs], laboratory operating procedures [LOP], sampling analysis plans [SAP], and mini-SAPs).

Purpose

The purpose is to recognize and anticipate all potential hazards associated with performing groundwater monitoring activities at SNL/NM.

Goals

The goal is to perform groundwater sampling and surveillance activities with zero occupational injuries and reportable occurrences. The activities are described in detail in the associated TWDs.

Objectives

The objectives are to perform work identified in the TWDs for groundwater monitoring activities by:

- Planning work so that potential hazards are recognized and controlled.
- Following health and safety protocols to prevent hazards to workers and protection of the environment.
- Executing work **only** as it is identified and described in the TWDs for groundwater monitoring activities listed in section 3.0. The work shall be performed in a manner that protects personnel from hazards, thus preventing injury.
- Limiting work activities to authorized and trained personnel.
- Improving this document and work processes (if necessary) based on feedback from personnel, safety case discussions, and lessons learned.

2.0 ROLES AND RESPONSIBILITIES

The Long-Term Stewardship Program is responsible for development, approval, distribution, revision, and control of this document.

IMPORTANT NOTICE:

The **Department Manager** is responsible for the following:

- Providing programmatic guidance leading to the development of this HASP.
- Reviewing and approving of this HASP.

The **Project Lead** or designee is responsible for the following:

- Reviewing and recommending approval of the HASP.
- Providing overall coordination and management of the GMP.
- Providing regulatory or programmatic requirements.
- Reviewing completed field forms and data pertaining to waste management and groundwater sampling activities.
- Reporting all information as required by regulations or directives.

The **Project Coordinator** is responsible for the following:

- Generating a mini-SAP from the SAP. The mini-SAP is a field friendly version of the SAP that:1) details sampling activities for the field support operations project leader and field technicians: 2) summarizes sampling procedures, analytical parameters, field measured parameters, purge requirements, and waste management tasks: and 3) identifies monitoring well characteristics that may extend the sampling period (e.g., low yield wells, well construction issues, etc.).
- Managing, coordinating, and disposing of purge water and other waste generated from field operations in compliance with SNL/NM <u>Corporate Policy ESH100 Environment</u> <u>Safety & Health</u>, and <u>FOP 05-04</u>, <u>Groundwater Waste Management Plan</u>.
- Providing the field support operations project leader with a copy of the mini-SAP.
- Coordinating waste management activities with the project leader and the field support operations project leader.
- Reviewing completed field forms and data pertaining to sampling activities.
- Ensuring that all data quality requirements are performed.
- Reviewing all analytical data used for waste characterization.
- Performing and documenting weekly inspections of Building 9925 Resource Conservation and Recovery Act (RCRA) Less Than 90-Day Waste Accumulation Area.
- Submitting completed field forms to the Customer Funded Record Center and entry of relevant data to the Environmental Data Management System (EDMS) database.
- Reviewing and providing recommendations for revisions to this plan (if necessary).

The Field Support Operations Team Leader is responsible for the following:

- Ensuring that safety and quality assurance procedures are followed.
- Supervising the field technicians.
- Reviewing training requirements for field technicians.
- Providing on-the-job training (OJT) of new field technicians.

- Assigning field technicians (qualified by training and experience) to conduct the activities described in this HASP.
- Providing field technicians with necessary equipment and supplies to conduct field work.
- Owner/manager/emergency coordinator of Building 9925 RCRA Less Than 90-Day Waste Accumulation Area.
- Reviewing and providing recommendations for revisions to this plan (if necessary).

The Field Technicians are responsible for:

- Stopping work if any operation threatens worker or public health and safety.
- Conducting tasks as described in the TWDs.
- Completing all necessary and required training as specified by the field support operations project leader.
- Conducting a tailgate safety meeting prior to the start of all field activities.
- Participate in the work Planning and Controls process, including the safety case discussions.
- Inspecting and maintaining equipment.
- Collecting, storing, and delivering samples to the Sample Management Office (SMO) in accordance with the SMO TWDs.
- Managing and disposing of waste as directed by completed <u>Work Request Forms</u>, and the field support operations project leader.
- Performing project inspections in accordance with associated TWDs.
- Completing and reviewing field documentation forms.
- Providing recommendations for revisions to this plan (if necessary).

The **Training Director** is responsible for:

 Reviewing, verifying, and documenting the completion of all training required for groundwater monitoring activities.

3.0 TRAINING QUALIFICATIONS

Personnel conducting field activities shall complete the following:

- Read applicable sections of SNL/NM <u>Corporate Policy ESH100 Environment Safety & Health</u>
- Read primary hazard screening (PHS) <u>SNL05A01241</u>, *Groundwater Monitoring Activities*.
- Read and sign <u>ALW 13-01.</u>, Activity Level Work Evaluation Form for the Groundwater Program.
- Read and sign AOP 95-16, Sample Management and Custody.
- Read and sign LOP 94-03, Sample Handling, Packaging and Shipping.
- Read and sign <u>FOP 05-01</u>, *Groundwater Monitoring Well Sampling and Field Analytical Measurements*.
- OJT for new field personnel performing groundwater monitoring activities if it pertains to any of the FOPs listed below. Document training by completing <u>On-the-Job Training</u> form (EP 2009-OJT).
- Read and sign <u>FOP 03-02</u>, LTS Groundwater Level Data Acquisition and Management.
 (Note: The training requirements denoted with an "*" in Table 3.1 below are all that are required for FOP 03-02.)
- Read and sign <u>FOP 05-02</u>, Groundwater Monitoring Equipment Field Check.
- Read and sign FOP 05-03, Groundwater Sampling Equipment Decontamination.
- Read and sign FOP 05-04, Groundwater Waste Management Plan.
- Read and sign <u>FOP 09-05</u>, *Conducting Slug Test Using Data Logger & Pressure Transducer* (only necessary if conducting slug test).
- Read and sign <u>FOP 10-01</u>, *Borehole and Downhole Well Video Inspection*. (<u>Note</u>: The training requirements denoted with an "*" in Table 3.1 below are all that are required for FOP 10-01).
- Read and sign plan (PLA) <u>PLA 13-02</u>, *Mixed Waste Landfill Long-Term Monitoring and Maintenance Health & Safety Plan*.
- Complete training courses listed in Table 3.1.
- Field personnel shall sign the <u>Authorized Users List</u> (<u>EP 2009-AUL</u>) to affirm they have read and understand this document, and agree to operate within the stated constraints.

Table 3.1 Training Course List

Course Code	Course Title	
*CHM100/103	Chemical Safety Training/Site-Specific Chemical Training	
ENV100	OSHA Health & Safety Basic Training - General Worker (40 HR)	
*ENV103	OSHA Health & Safety Training Refresher (8 HR)	
*ENV112	Hazardous Waste & Environmental Management Training	
ENV216	RCRA - Less Than 90-Day Area Accumulation Area for Owners &	
	Emergency Coordinators	
ENV316	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers	
ENV416	RCRA - Less Than 90-Day Area Accumulation Area for Waste Workers -	
	Site-Specific	
*ESH100	ES&H Awareness	
FKL153	Forklift Operator and Hands-On Training	
*MCH200	Hand and Power Tool Safety	
*MED102	Standard First Aid	
*MED104	Heartsaver CPR	
*OTS101	Occupational Thermal Stress	
PKX050	Site Specific Packaging and Transportation of Hazardous Materials	
	Training	
PKX100	Basic Hazardous Material Transportation Training	
*PPE106	Personal Protective Equipment Training	
PRS150	Pressure Safety Orientation	
PRS250	Advanced Pressure Safety	
*RAD102	General Employee Radiological Training	
RAD230	Radiological Worker II Training	

NOTES: *Training requirements are all that are required for FOP 10-01

CPR = Cardiopulmonary Resuscitation

ES&H = Environment, Safety and Health

HR = hour

OSHA = Occupational Safety and Health Administration

RCRA = Resource Conservation and Recovery Act

4.0 **SCOPE OF WORK**

The scope of work covered by this HASP only includes the activities as they are identified and described in the TWDs listed in Section 3.0. This HASP can not be utilized for any other work without the explicit authorization from the field support operations project leader or higher authority.

5.0 PERSONAL PROTECTIVE EQUIPMENT

Personnel are required to wear the personal protective equipment (PPE) identified by the task hazard analysis described in Section 6.0. Level D PPE will be the minimum level of protection for all activities (Table 6.1).

6.0 TASK HAZARD ANALYSIS

All activities associated with this HASP shall be covered by the PHS. <u>Activity Level Work Evaluation Form</u>, <u>EP 2009-ALW</u>, was completed and approved according to <u>AOP 09-10</u>, *Work Planning and Controls*, and documented in the groundwater program safety case (ALW 13-01).

Task hazard analyses (THA) have been performed on all groundwater activities in conjunction with PHS SNL05A01241, LTS Groundwater Monitoring Activities. The PHS helps identify potential hazards that can be expected when performing the work. The THA classifies the potential hazards and rates them based on the probability of occurrence (Table 6.1). The THA identifies control measures that will be used to mitigate the potential hazards (Table 6.1). The control measures may include courses and training that are identified as part of the PHS results. This approach to identifying, rating, and controlling hazards is consistent with SNL/NM's Integrated Safety Management System. The hazards rating are low for all activities identified in groundwater monitoring activities. Field technicians shall comply with PLA 13-02 during groundwater activities at the Mixed Waste Landfill, applicable FOPs when performing groundwater monitoring, in addition to requirements listed in this HASP.

Hazard assessment surveys were performed for groundwater sampling activities by an SNL/NM industrial hygienist. The hazard assessment survey reports concluded that the potential for exposure to health hazards has been categorized as well-controlled and acceptable.

- SNLNM00825, 9925/1 (High-Bay) (equipment decontamination)
- SNLNM00827, Groundwater Monitoring: Roving (groundwater sampling)
- SNLNM01481, Groundwater Surveillance: Roving (measuring groundwater levels)
- SNLNM01520, *Chemwaste Landfill Groundwater Surveillance: Roving* (measuring groundwater levels at the Chemical Waste Landfill)

Groundwater monitoring activities occur at various monitoring wells located on Kirtland Air Force Base (KAFB) and SNL/NM. The following is a list of activities performed:

- > Equipment decontamination
- > Calibration of monitoring equipment
- > Collecting a depth-to-water measurement
- ➤ Lowering of pumps and or monitoring equipment (camera, data logger, water level meter)
- > Operating pumping equipment to purge the well (or sample line)
- ➤ Monitoring (measuring) chemical properties of water
- > Operating pumping equipment to fill sample bottles
- > Raising pumping equipment after samples have been collected
- > Raising monitoring equipment
- > Managing samples
- ➤ Managing waste water
- Measuring depth to water in monitoring wells

- > Performing borehole and downhole well video inspections of monitoring wells
- > Performing slug tests at monitoring wells
- > Performing data logger monitoring at monitoring wells
- > Documenting all activities

Table 6.1. Task Hazard Analysis - *Level of Protection* – Level D PPE (safety shoes/boots, chemical safety goggles)

	Potential Hazard	Hazard Rating	Control
Chemic	al	Low	
1)	Decontamination of pump tubing using a diluted nitric acid (HNO ₃) rinse and a detergent rinse.		Wear chemical safety goggles and latex or nitrile gloves when handling potential chemical hazards. Portable eyewash is located in sampling vehicle. No eating,
2)	Groundwater containing volatile organic compounds (VOCs), nitrates & nitrites (20 parts per million (ppm).		drinking, and smoking will be permitted around sampling operations. All purge water is treated as a non-regulated waste (based on process knowledge of prior sampling)
3)	Sample preservatives include sodium hydroxide (NaOH), hydrochloric acid		until analytical results show otherwise.
	(HCl), HNO ₃ , and sulfuric acid (H ₂ SO ₄). Standardized solutions include Zobell solution, potential of hydrogen (pH) buffers, electrical		Material Safety Data Sheets (MSDSs) kept in sampling vehicle or obtained through the SNL/NM Chemical Information System.
	conductivity solution.		When discharging (dumping) drums requires mandatory
4)	Spill of liquids (water) during operation of drum handler.		2-person team and follow guidance in the equipment manual provided by the manufacturer.
5)	Generation of hot water and steam during equipment decontamination activities.		Use of steam cleaning equipment requires a mandatory 2-person team and follow guidance in the equipment manual provided by the manufacturer.
Mechanical		Low	
1)	Motorized reel for raising and lowering groundwater monitoring equipment.		Be aware of potential pinch points. Do not wear loose fitting clothing, dangling badges or jewelry when operating this equipment.
2)	Hydraulic lift on back of sampling vehicle.		

Table 6.1. Task Hazard Analysis - *Level of Protection* – Level D PPE (safety shoes/boots, chemical safety goggles) (concluded)

Potential Hazard	Hazard Rating	Control	
Mechanical (continued) 3) Operation of forklift. 4) Operation of drum handler. 5) Operation of field vehicles. Physical 1) Heat exhaustion & hypothermia. 2) Sunburn. 3) Lifting injury from equipment, pumps, and 55-gallon drums containing purge water. 4) Operation of water level meter (shoulder strain). 5) Lowering and raising groundwater monitoring equipment (back strain). 6) Slips, trips, and falls. 7) Tools.	Low	Keep equipment within maintenance schedule and compliance. Keep current with training requirements. Requires use of "spotter" personnel when deemed necessary for safe operations. 1) Weather conditions are addressed in Tailgate Safety Meeting. Workers trained on heat exhaustion & hypothermia. Wear appropriate clothing and hydrate as necessary. 2) Provide workers with sunscreen. 3) Use proper lifting techniques. Utilize hydraulic lift on back of sampling vehicle and a forklift with a SNL/NM approved drum handler. 4) Use water level meter support device. 5) A motorized reel is used to lower and raise the pump. 6) Maintain proper housekeeping of work area. Use step stools. 7) Use correct tools and inspect them prior to use.	
Radiological	Low	None are expected although a minimum of (Radiological Awareness or Radworker I) training is required.	
Fire	Low	Fire extinguishers are located in mobile equipment.	
Biological • Snakes, rodents, insects	Low		

7.0 WORK PRACTICES

The following work practices will be enforced:

- All personnel must comply with Occupational Safety and Health Administration, U.S. Department of Energy, and SNL/NM requirements regarding health and safety.
- No task will be performed until a PHS and THA has been prepared and reviewed with the personnel performing the task.
- All personnel must conduct their activities in a manner pursuant to the contents of this HASP.
- A tailgate meeting will be held prior to starting the day's sampling activities.
- Any unnecessary contact with potentially contaminated substances must be avoided. This includes contact with potentially contaminated surfaces and/or equipment.

- Eating, drinking, smoking, chewing gum or tobacco, or any other hand-to-mouth activities are prohibited in the sampling vehicle lab.
- A "buddy system" is implemented for all groundwater sampling activities. A "buddy system" is defined as a system of organizing personnel into work groups in such a manner that each member of the work group is designated to be observed by at least one other member in the group. The purpose of the "buddy system" is to provide rapid assistance to sampling personnel in the event of an emergency. In addition, a person is required to report his/her destination when leaving the other team member(s).
- All members of the sampling crew will carry a cell phone or portable radio capable of contacting the Emergency Operations Center (EOC).
- All members of the sampling crew will carry an EOC pager so they can be notified of any KAFB emergencies or weather alerts.
- An ABC fire extinguisher will be located in each of the field sampling vehicles.
- An eyewash device will be located in each of the sampling vehicles.
- A First Aid kit will be located in each of the sampling vehicles.

8.0 TAILGATE SAFETY MEETING

A field technician or field support operations project leader must conduct a tailgate safety meeting and fill out a <u>Tailgate Safety Meeting Form</u> prior to the start of groundwater sampling activities. The person conducting the meeting must possess knowledge of groundwater sampling activities and the topics discussed in this HASP. All personnel/visitors who attend the meeting must document that they have attended and understood the meeting by signing the <u>Tailgate Safety Meeting Form</u>.

9.0 SHUTDOWN OF WORK ACTIVITIES

All individuals have the authority to shutdown groundwater monitoring activities if they feel that safety is being compromised. A shutdown could be the result of the following:

- Personnel not following health and safety protocols.
- Not having the appropriate safety gear on site (eyewash, first aid kit, fire extinguisher, appropriate PPE).
- Inadequate equipment or equipment failure.
- Weather
 - ➤ If lightning is observed within 5 miles (25 seconds from time of flash to thunder) or the EOC issues a lightning warning (via EOC pager).
 - ➤ High winds (greater than 40 miles per hour).
 - > Severe snow storms (discretion of sampling crew).
 - > Severe rain storms (discretion of sampling crew).
 - > Severe heat or cold (discretion of sampling crew).
 - > Tornado warnings.
- Unsafe conditions around sampling location (discretion of sampling crew).

 Any unsafe condition(s) noted during performance of groundwater monitoring activities or off-normal events.

In the event that work is stopped due to:

- Safety-related issues,
- an injury incurred while performing the tasks identified in this procedure, or
- as the result of an audit,

the field technicians shall immediately notify the project coordinator, field support operations project leader, the project leader, and the department manager. The field technicians shall seek the assistance of the field support operations project leader for the mitigation of the hazard and the completion of a Work Resumption Authorization Form (EP 2009-WRA) as required by AOP 09-10, Work Planning and Control. The department manager shall sign the completed form prior to the restart of work.

10.0 EMERGENCY RESPONSE PLAN

During groundwater monitoring activities, the potential for fire, explosion, or unplanned release of radionuclides or RCRA regulated hazardous waste or waste constituents that would significantly threaten human health or the environment is very low. In the unlikely event of an emergency, the SNL/NM EOC will provide coordination, resources, and appropriate emergency equipment on an as-needed basis. In case of an emergency:

- Stop work.
- Alert other personnel in the affected area.
- Evacuate the immediate area.
- Notify the appropriate resources or points of contact listed in Table 10.1.

Table 10.1. Points of Contact and Emergency Telephone Numbers

Resources and Contact	Telephone Number
SNL/NM Incident Command System	911
(Fire, Ambulance, etc.)	(505-844-0911 from cell phone)
SNL/NM Medical Clinic	845-8159
SNL/NM Non-Emergency Number	311 or 844-6515
Poison Control Center	272-1222
Sandia Security / Key Service	North: 844-4657
	South: 845-3114
ES&H concerns	844-6515
National Response Center	900 922 0761
(Environmental Emergencies)	800 822-9761
Personnel to Notify if	an Incident Occurs
SNL/NM Project Coordinator	office: 284-2547
Tim Jackson	mobile: 263-6639
SNL/NM Project Leader	office: 284-2483
Michael Skelly	mobile: 270-5170
SNL/NM Department Manager	office: 844-3185
Pamela Puissant	mobile: 239-9144
Center 4100 ES&H Coordinator	office: 284-9707
Noel Duran	mobile: 270-8822

10.1 Directions to Medical Facilities

<u>Directions to SNL/NM Medical Facility:</u> From Technical Area I (TA-I) proceed to Harding Boulevard and/or Wyoming Boulevard. On Hardin Boulevard proceed west to Wyoming Boulevard. Turn right (north) on Wyoming Boulevard and travel north to F Street. Turn right (east) on F Street and proceed to 7th Street. The medical facility is located at the west end of Building 831 at the intersection of F and 7th Streets.

From Technical Area II (**TA-II**) proceed to East Ordnance Road. Proceed west on East Ordnance Road to Wyoming Boulevard. Turn right (north) to F Street. Turn right (east) on F Street and proceed to 7th Street. The medical facility is located at the west end of Building 831 at the intersection of F and 7th Streets.

From **Tijeras Arroyo** proceed to the Landfill Road. Proceed southwest on Landfill Road to Pennsylvania Street. Turn right on Pennsylvania Street and travel northwest to Wyoming Boulevard. Turn right (north) on Wyoming Boulevard and travel north to F Street. Turn right (east) on F Street and proceed to 7th Street. The medical facility is located at the west end of Building 831 at the intersection of F and 7th Streets.

See Attachment A for SNL/NM Medical Clinic location map.

11.0 REFERENCES

Sandia National Laboratories, <u>Corporate Policy ESH100 Environment Safety & Health</u>, SNL/NM.

Sandia National Laboratories, Sample Management Office, <u>AOP 95-16</u>, Sample Management and Custody (latest edition), SNL/NM.

Sandia National Laboratories, Sample Management Office, <u>LOP 94-03</u>, *Sample Handling, Packaging and Shipping* (latest edition), SNL/NM.

Sandia National Laboratories, Environmental Programs and Assurance Department, <u>FOP 03-02</u>, Long Term Environmental Stewardship Water Level Data Acquisition and Management (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-01</u>, *Groundwater Monitoring Well Sampling and Field Analytical Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-02</u>, *Groundwater Monitoring Equipment Field Check for Water Quality Measurements* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-03</u>, *Groundwater Monitoring Equipment Decontamination* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 05-04</u>, *Groundwater Monitoring Waste Management* (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>FOP 09-05</u>, Conducting Slug Test Using Pressure Transducer and Data Logger (latest edition), SNL/NM.

Sandia National Laboratories, Environmental Programs and Long-Term Stewardship, FOP 10-01, *Borehole and Downhole Well Video Inspection*, (latest edition), SNL/NM.

Sandia National Laboratories, Long-Term Stewardship, <u>PLA 13-02</u>, *Mixed Waste Landfill Long-Term Monitoring and Maintenance Health & Safety Plan* (latest edition), SNL/NM.

Sandia National Laboratories, Environmental Programs and Assurance Department, PHS <u>SNL05A01241</u>, *Long Term Environmental Stewardship Groundwater Monitoring Activities* (latest edition), SNL/NM.

Attachment A

SNL Medical Facilities Location Map

This page intentionally left blank

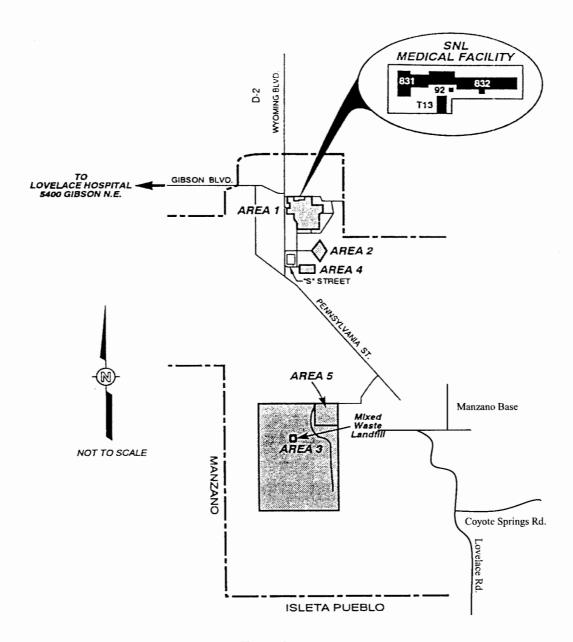


Figure 2

Medical Facilities Location Map, Sandia National Laboratories

This page intentionally left blank