



Chemical Waste Management, Inc.

9131 East 96th Avenue
Henderson, Colorado 80640
303/289-4827

January 2, 1990

Mr. Gary M. Mavrakis
Manager, Chemical Support
Signetics Company
9201 Pan American Fwy, N.E.
P.O. Box 10272, MS107
Albuquerque, New Mexico 87184

Dear Mr. Mavrakis:

This letter serves as documentation of activities conducted by Chemical Waste Management for the Signetics Company during the week of December 26, 1989.

On December 26, 1989, Chemical Waste Management mobilized from Henderson, Colorado to Albuquerque, New Mexico.

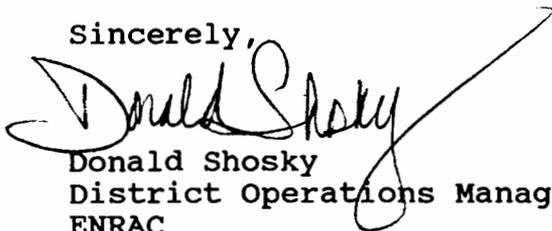
On December 27 and 28, 1989, Chemical Waste Management performed on-site services at the Signetics plant in Albuquerque, New Mexico. The work accomplished those days included:

1. Removing a 5,000 gallon solvent tank;
2. Cleaning a sump where the waste solvent tank was located;
3. Inerting the waste solvent tank;
4. Removing the remaining fluids from the tank;
5. Triple rinsing the tank;
6. Cutting the tank;
7. Loading the decontaminated tank into roll-off bin; and
8. Disposing of the decontaminated tank from the vault.

After the tank was removed it was placed on a 4 ml visqueen liner. The tank was cold cut after being inerted for easy access. Once the opening in the tank was completed, residual liquids were removed and the tank triple rinsed. The rinse water and sludges were removed and placed in 55-gallon drums. The tank was then cut into pieces and placed in a roll-off bin. The roll-off bin was sent off site on December 29, 1989 to a Waste Management facility in Albuquerque, New Mexico for disposal.

If you have any questions, please contact me at (303)289-4827.

Sincerely,


Donald Shosky
District Operations Manager
ENRAC

DS:pmc *pmc*
Enclosures